




MONTÁŽNY NÁVOD JEDNOKRÍDLOVÁ BRÁNA FG/S-SSG-R7016-SET



4-6 hodín




1 osoba

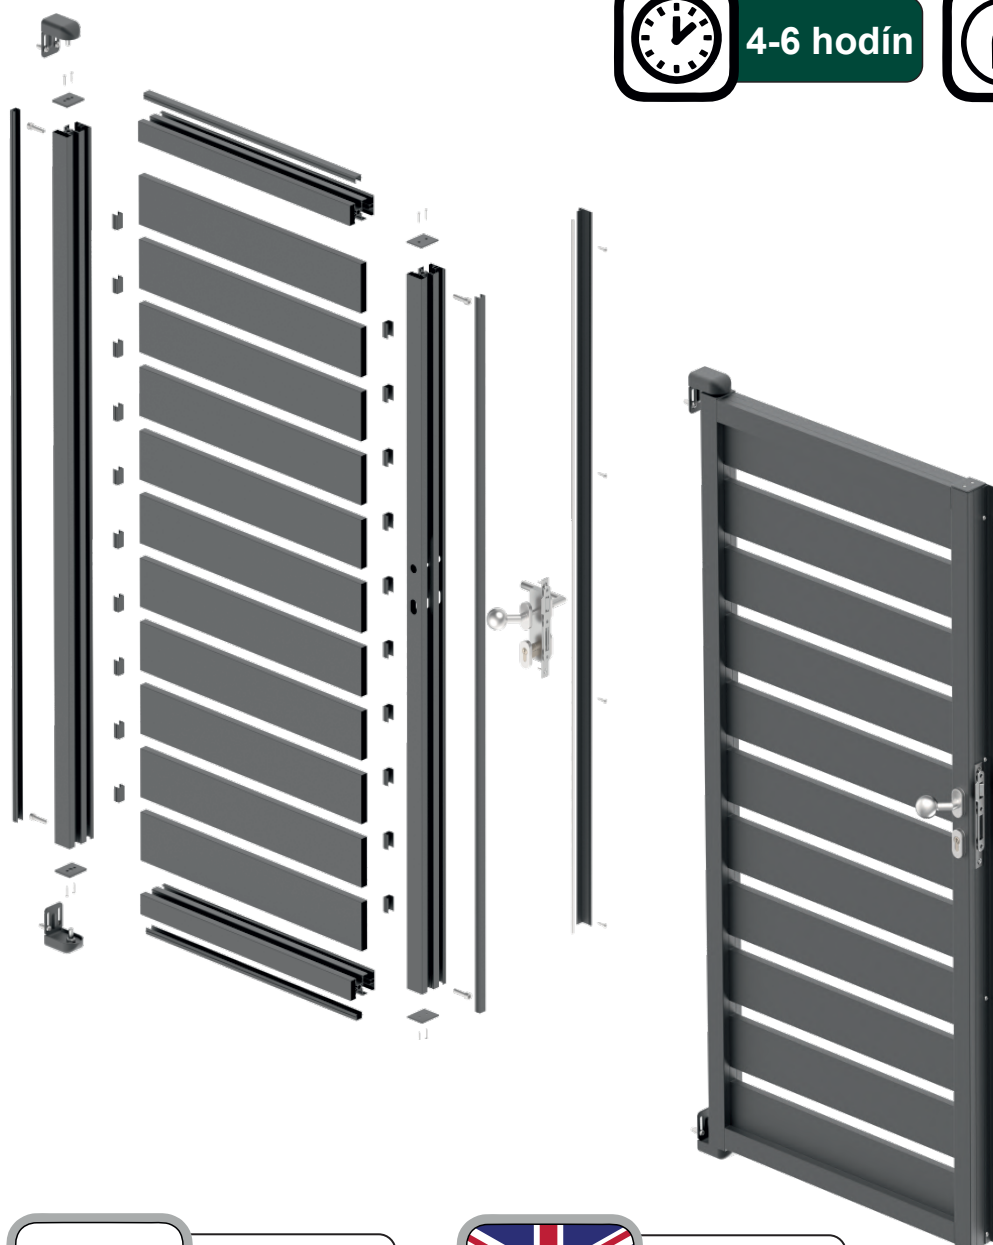


SK verzia



EN version











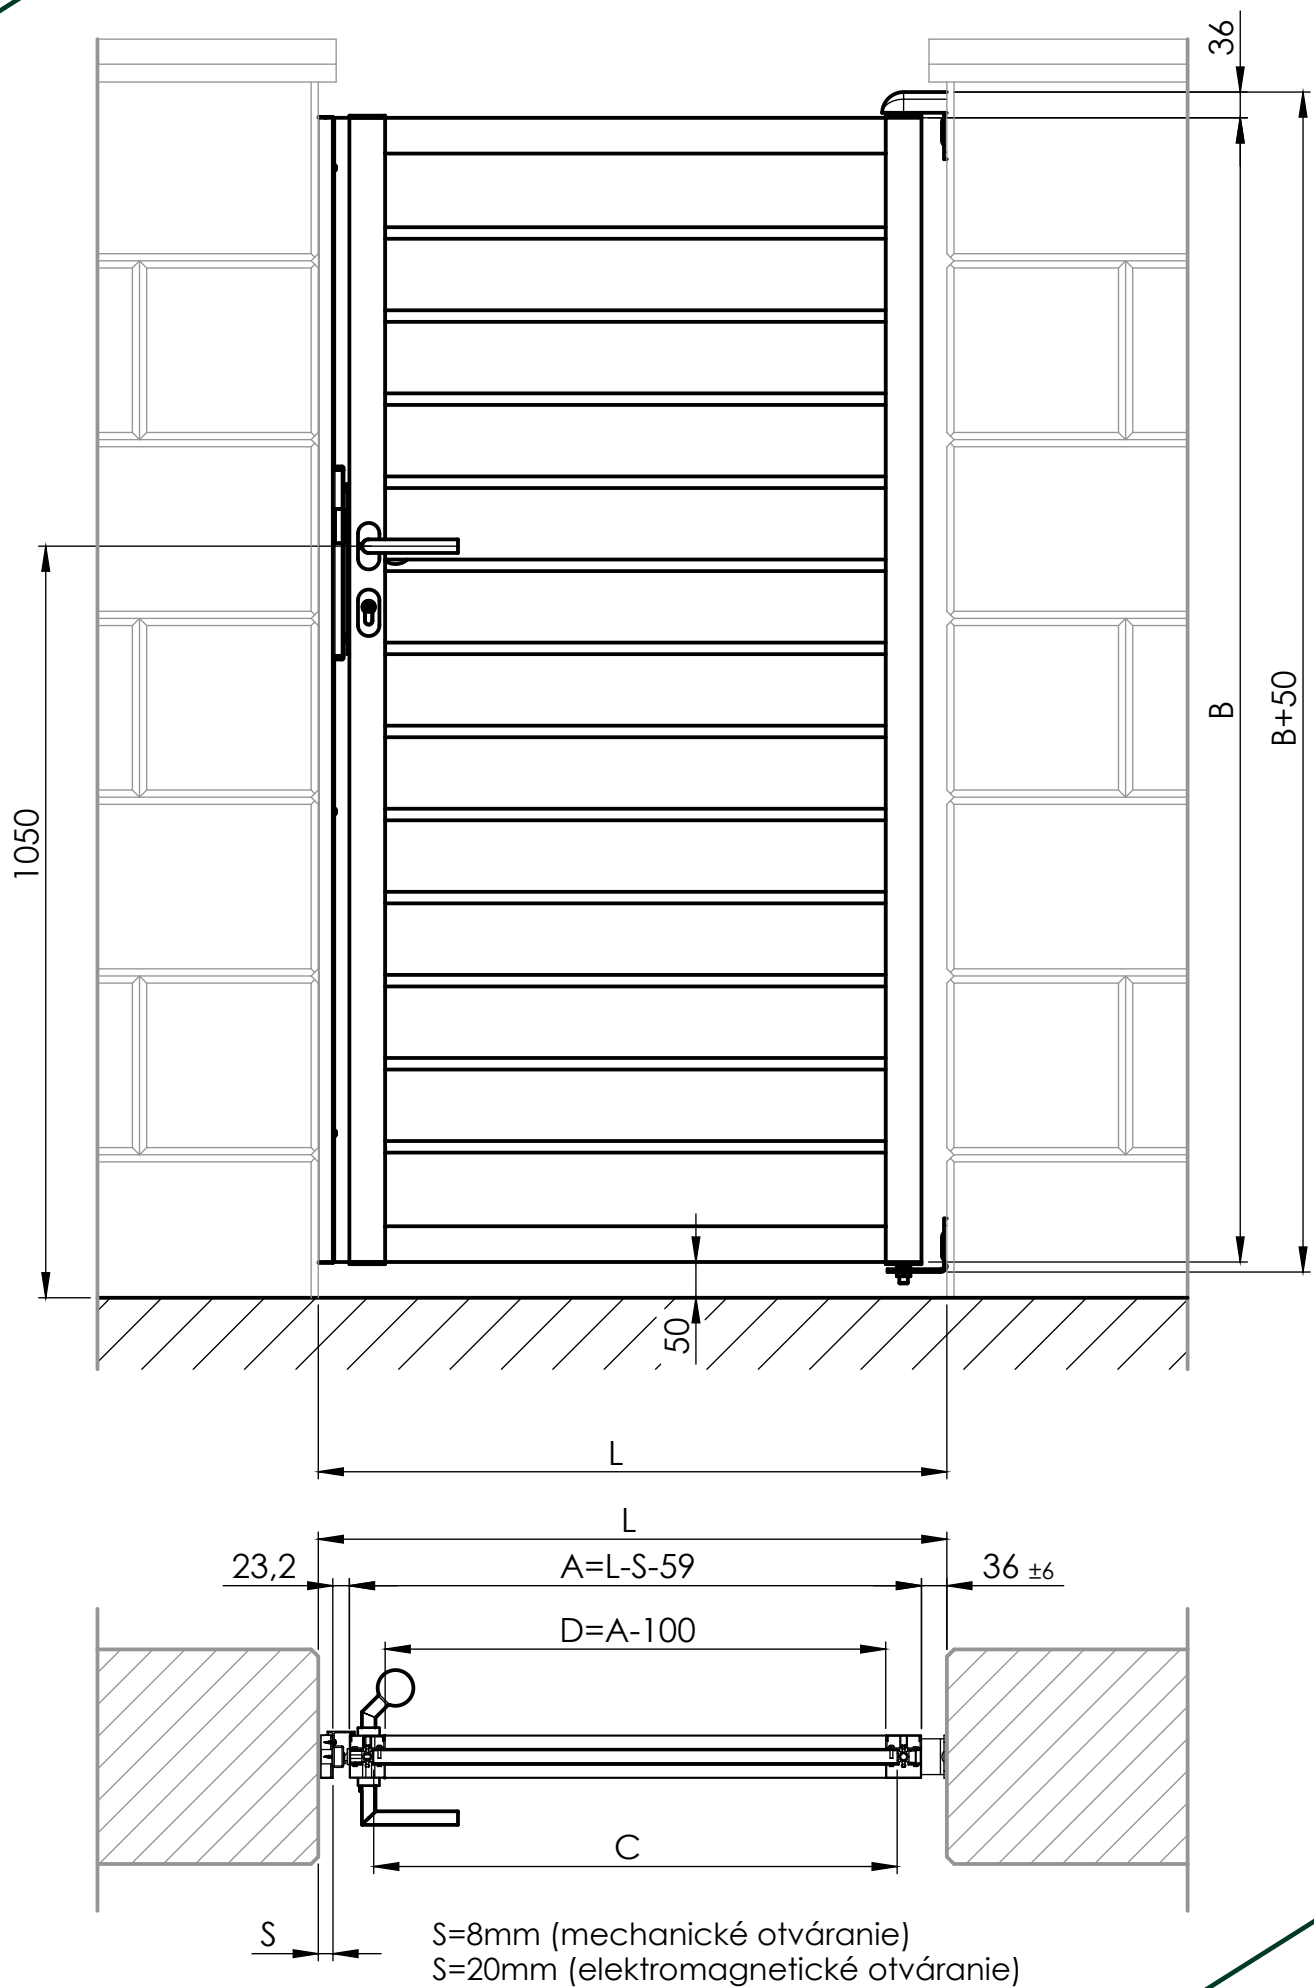


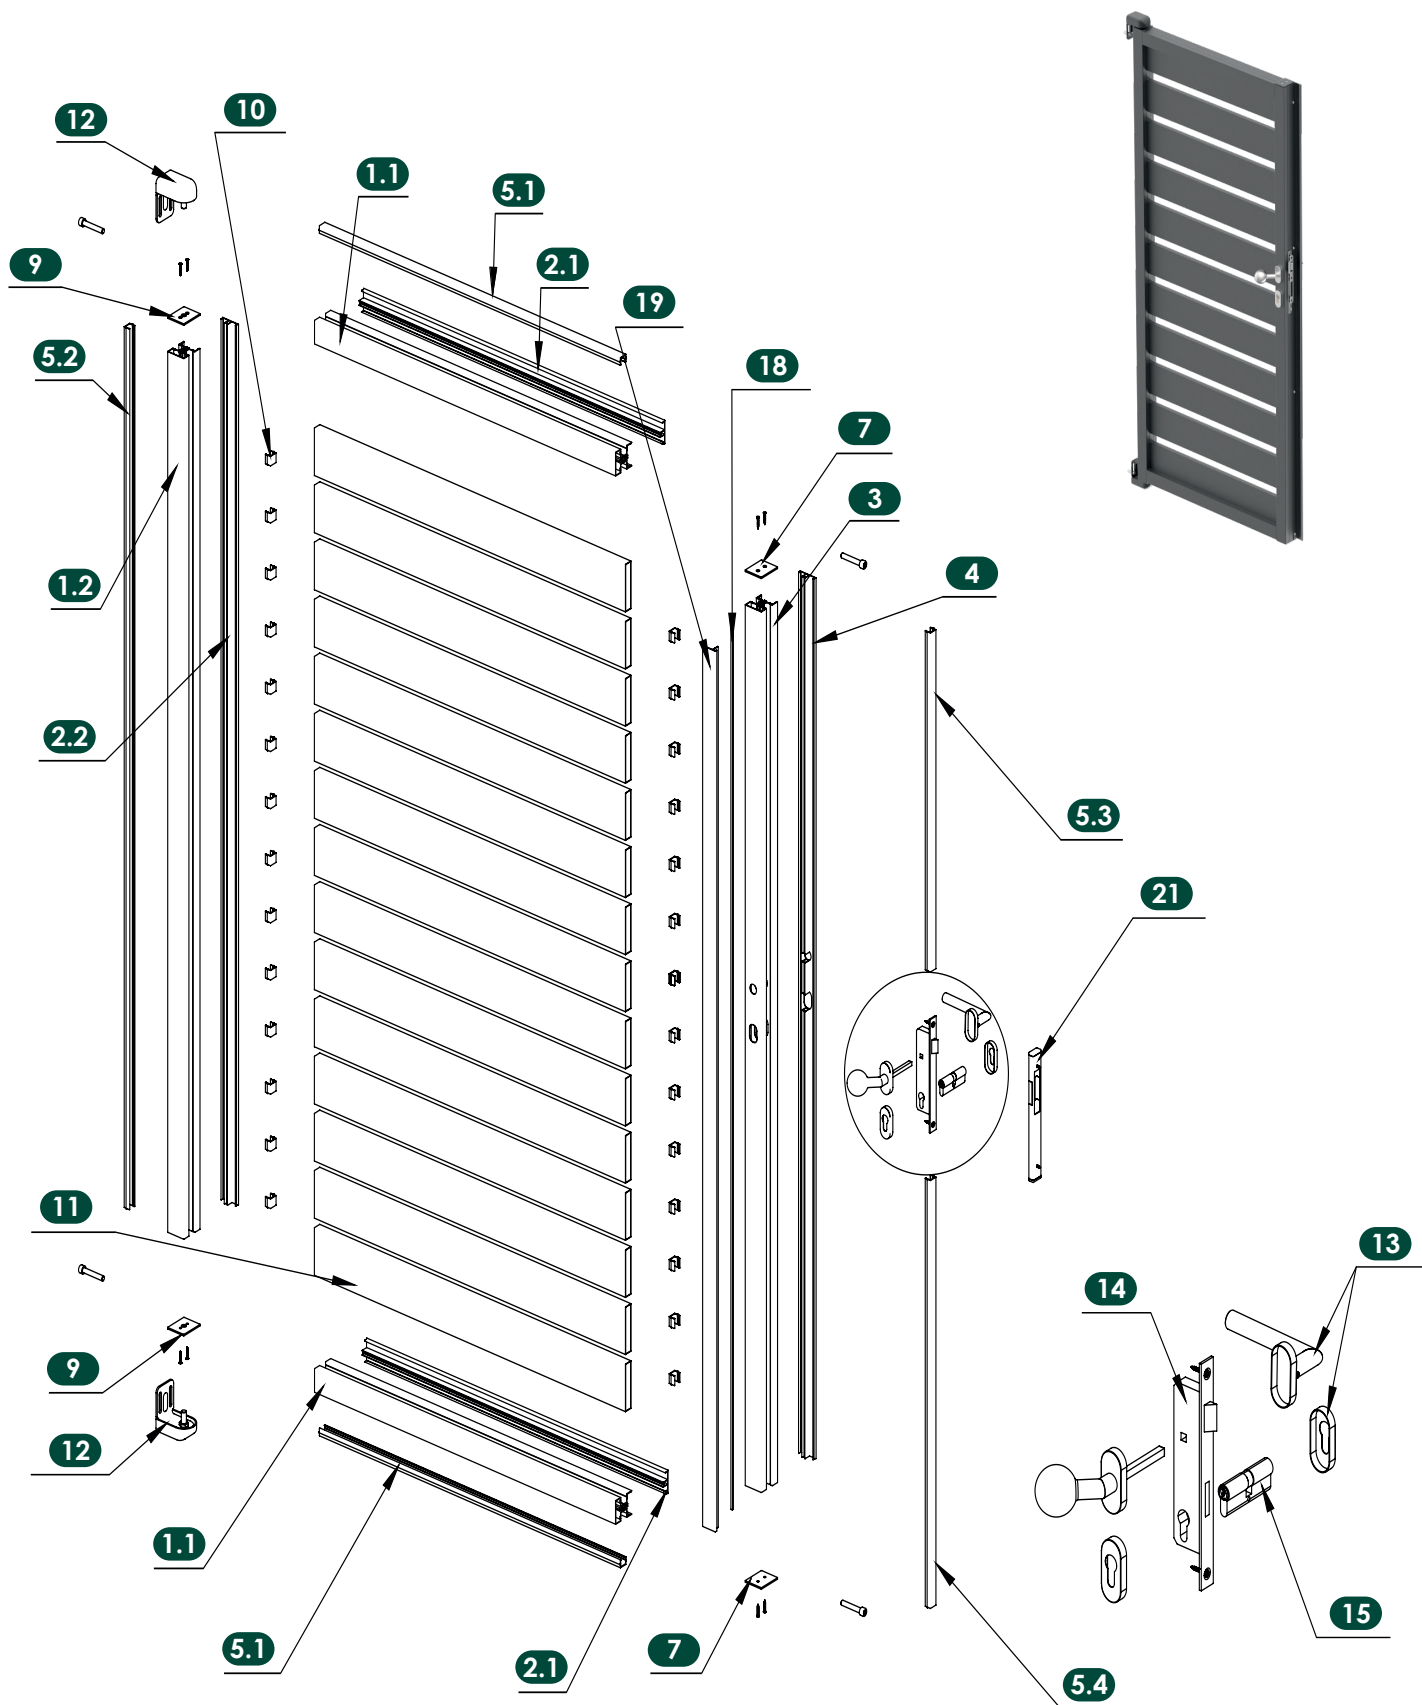

FG/S-SSG-R7016-SET



KOMPONENTY

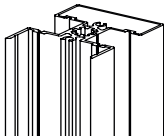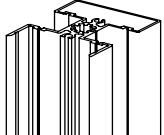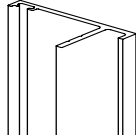N.	DĹŽKA (mm)	KAT. Č.	OBRÁZOK	QTY	N.	DĹŽKA (mm)	KAT. Č.	OBRÁZOK	QTY
1.	1.1 D=A-100	FG/FP50x60-1850-R7016		2x	12.		D4/84-40x40-GREY		1x
	1.2 B (1850)								
2.	2.1 D=A-100	FG/PC49x17-1850-R7016		2x	13.		D8/05G-L-i		1 pár
	2.2 B (1850)								
3.	B (1850) MECHANIZÁCIA	FG/FP50x60M-1850-R7016		1x	14.		B1/30-25x90		1x
4.	B (1850) MECHANIZÁCIA	FG/PC49x17M-1850-R7016		1x	15.		B1/19N-80		1x
5.	5.1 D=A-100	FG/PC20x16-1850-R7016		3x	16.		A-DIN 7505A 5x35		2x
	5.2 B (1850)								
	5.3 B-1064								
	5.4 874								
6.		A-DIN 912-A2 M10x60		4x	17.		A-DIN 7504K-A2 4,2x16		60x
7.		FG/CP50x60-R7016		2x	18.	B (1850)	A19/4466-M		2m
8.		A-DIN 7505A 5x20		8x	19.	B (1850)	FG/DS40x20-2000-R7016		1x
9.		FG/CH50x60-R7016		2x	20.		A-PH 5x20		5x
10.	20	FG/PC20x16-20-R7016		28x	21.		B8/07T-30x15		1x
11.	C=A-68 (15ks)	FG/S20x100x1-3000-R7016		5x					

REZANIE PÍLOU

1.1
2x

2.1
2x


5.1
2x

5.1
2x

1.1
2x

2.1
2x

$D=A-100$

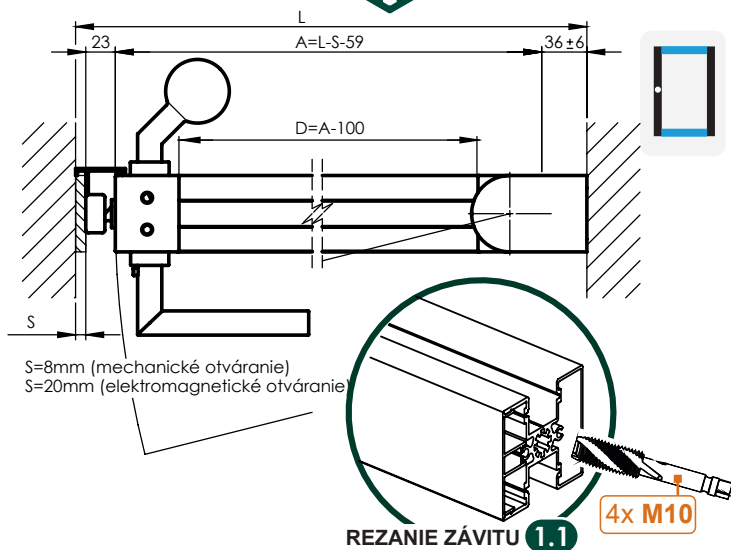

2x Ø 10,2 mm

PRE SPOJENIE RÁMU BRÁNY


2x Ø 12 mm

ROZŠÍRENIE OTVORU PRE ČAP PÁNTU

2x Ø 10,2 mm

VŔTANIE 1.2

2x Ø 12 mm

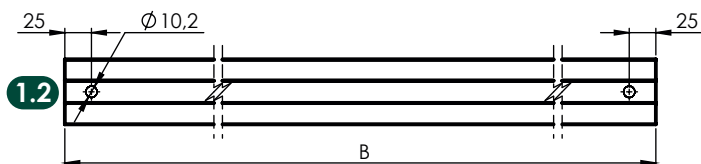


2x Ø 10,2 mm

PRE SPOJENIE RÁMU BRÁNY

2x Ø 10,2 mm

VŔTANIE 3

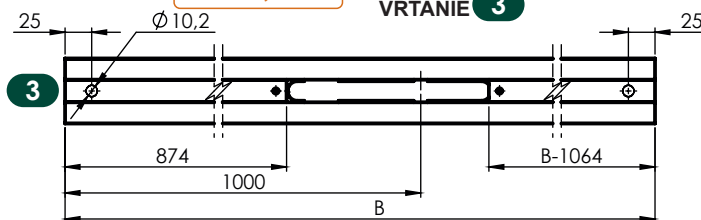



REZANIE PÍLOU

11
5x


11
5x

$C=A-68$

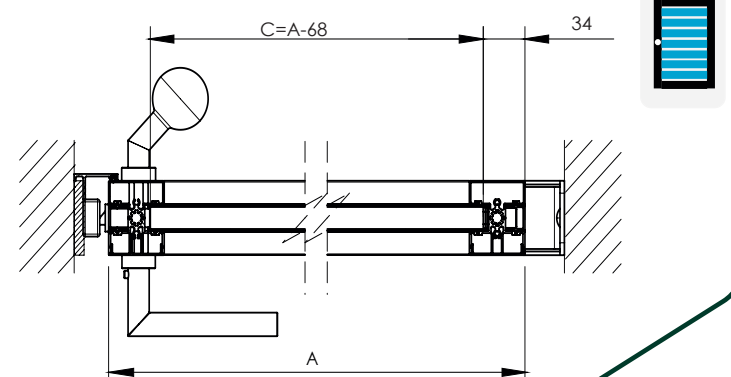

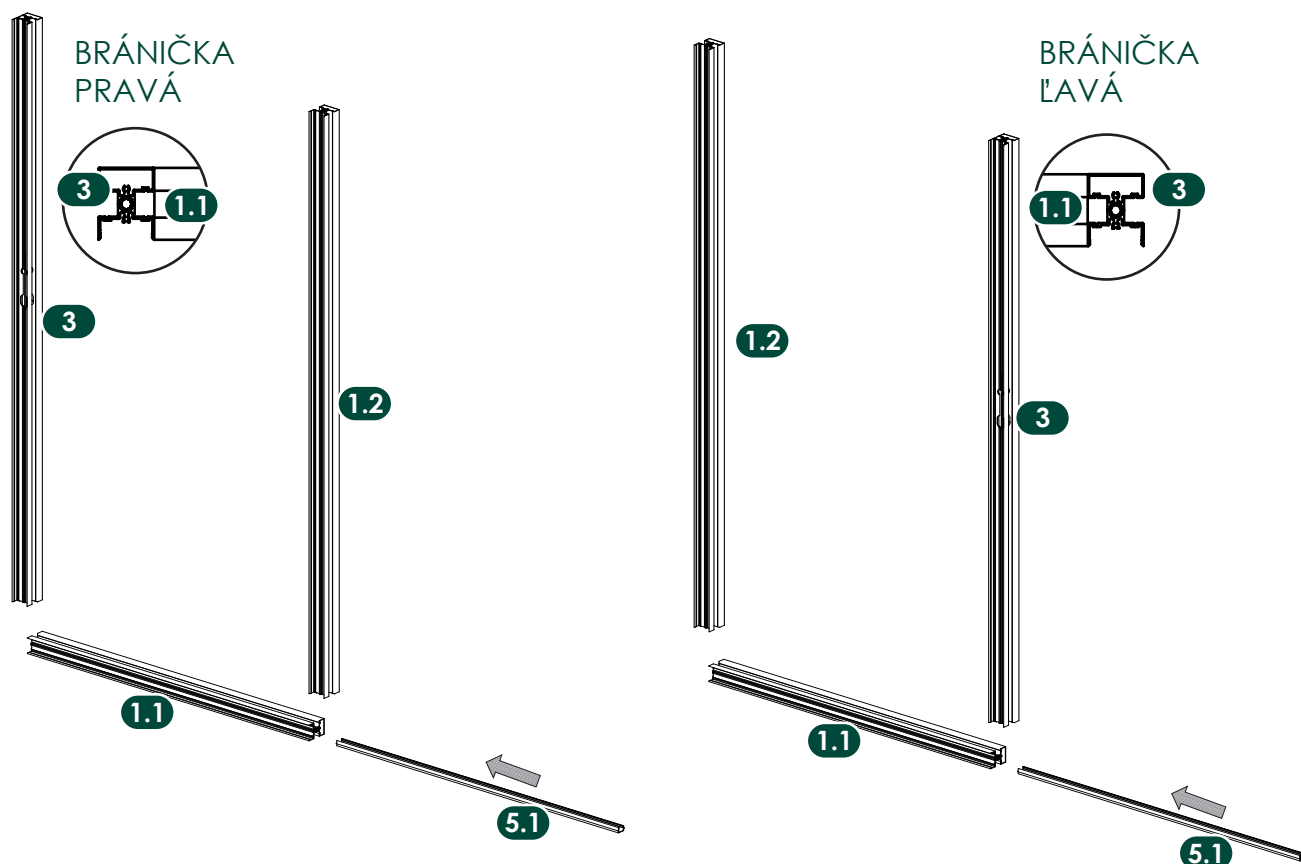

5.

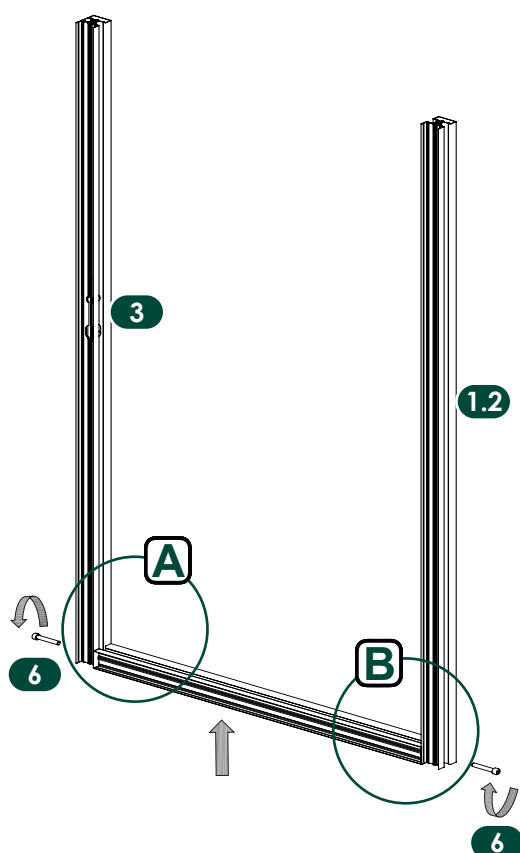

6.

DETAIL


A

DETAIL

B

strana
11



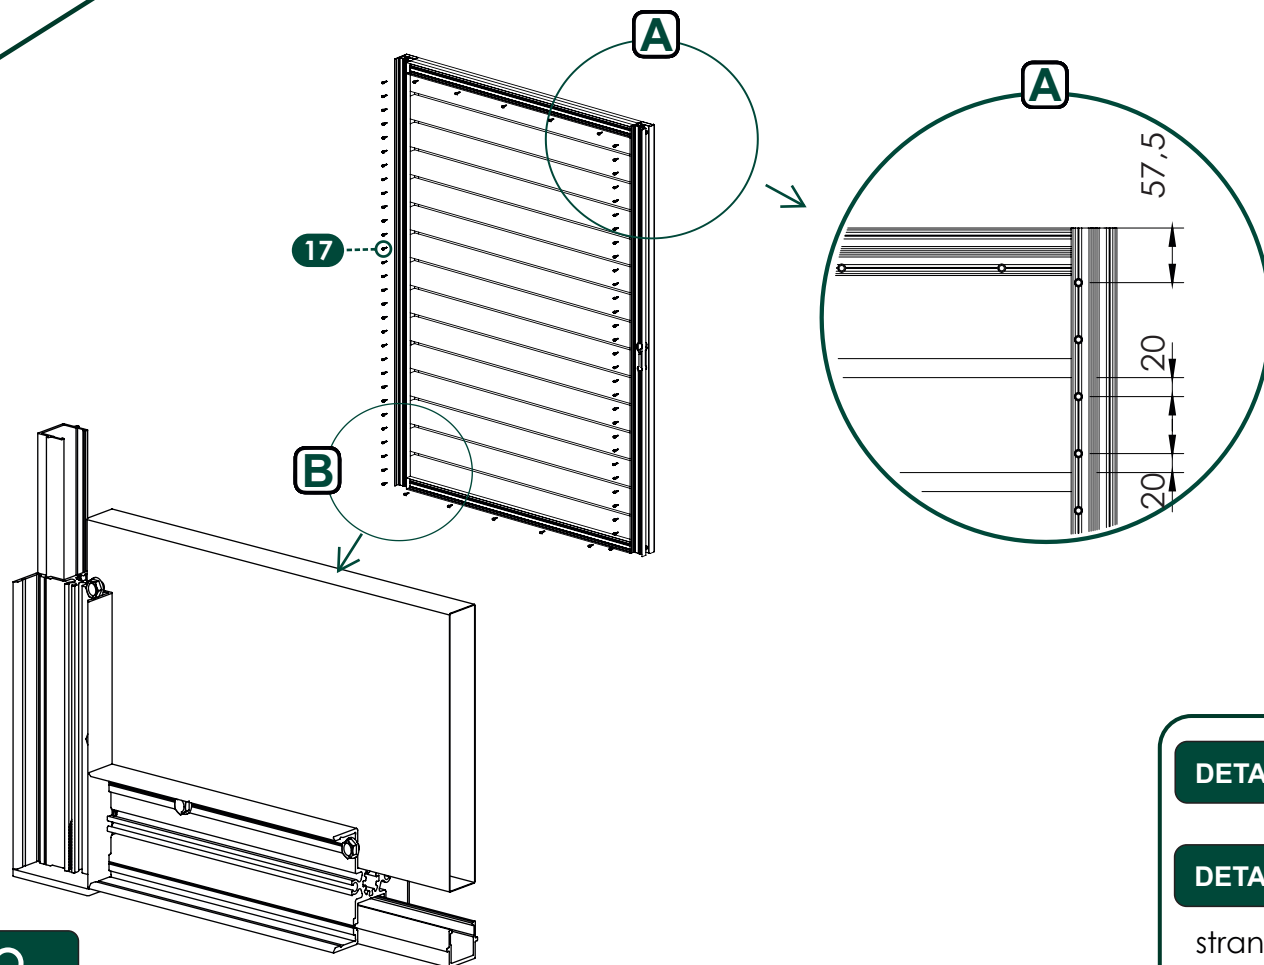

9.


DETAIL

A


DETAIL

B


strana
11

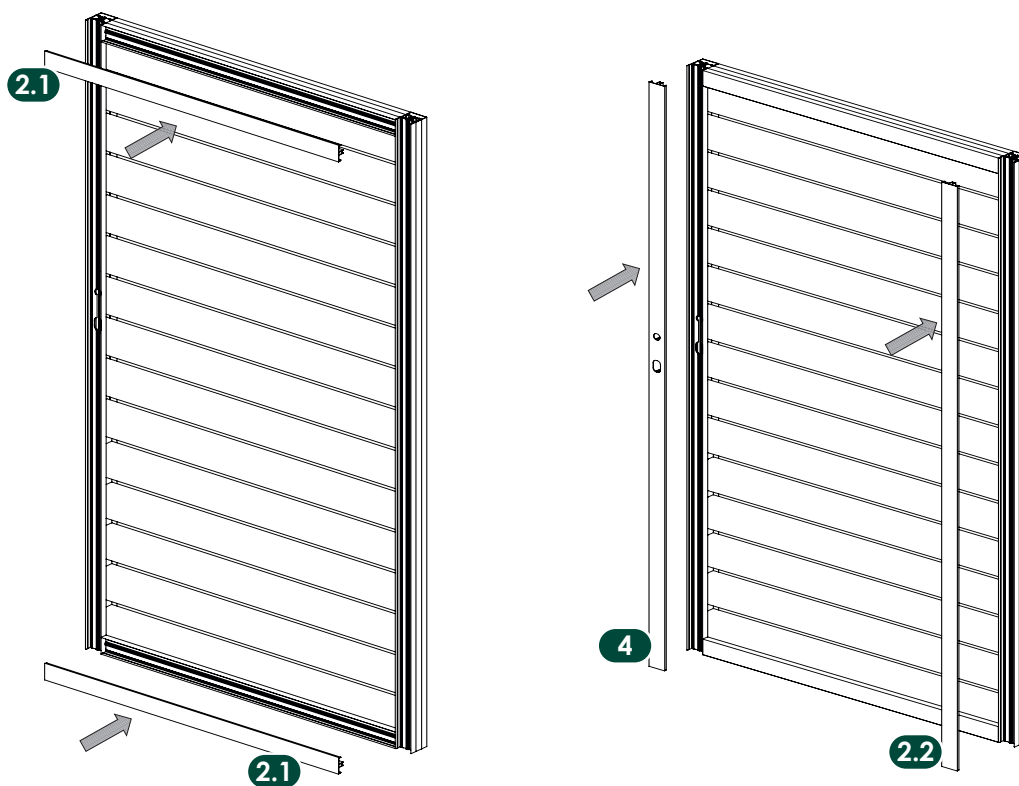


10.

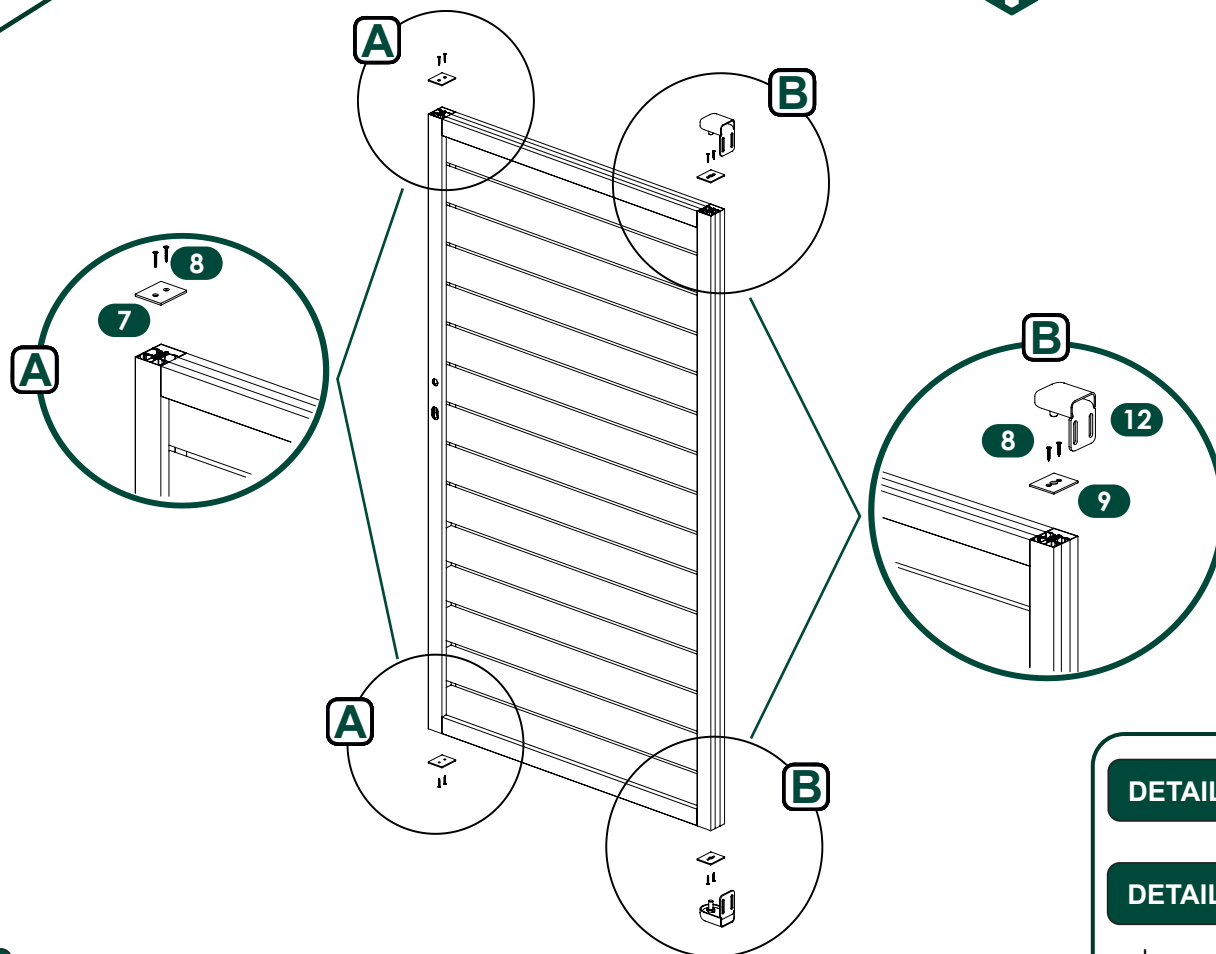


11.

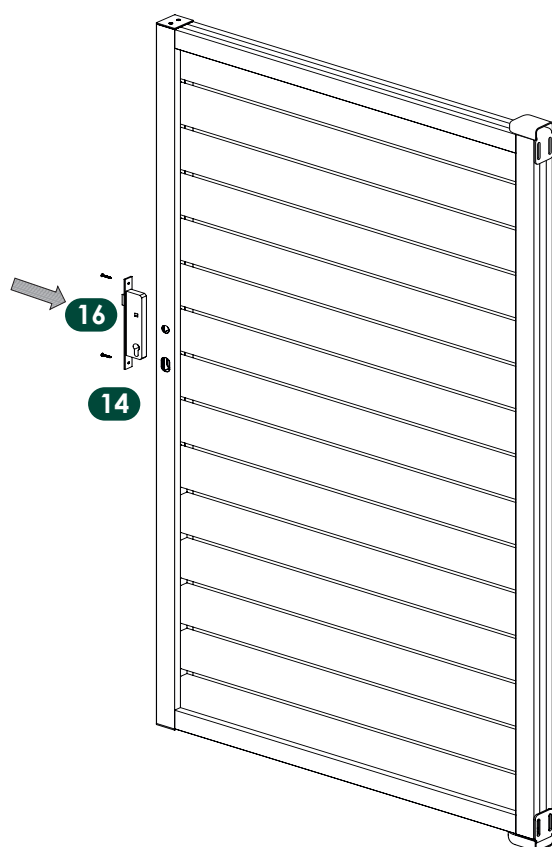

12.

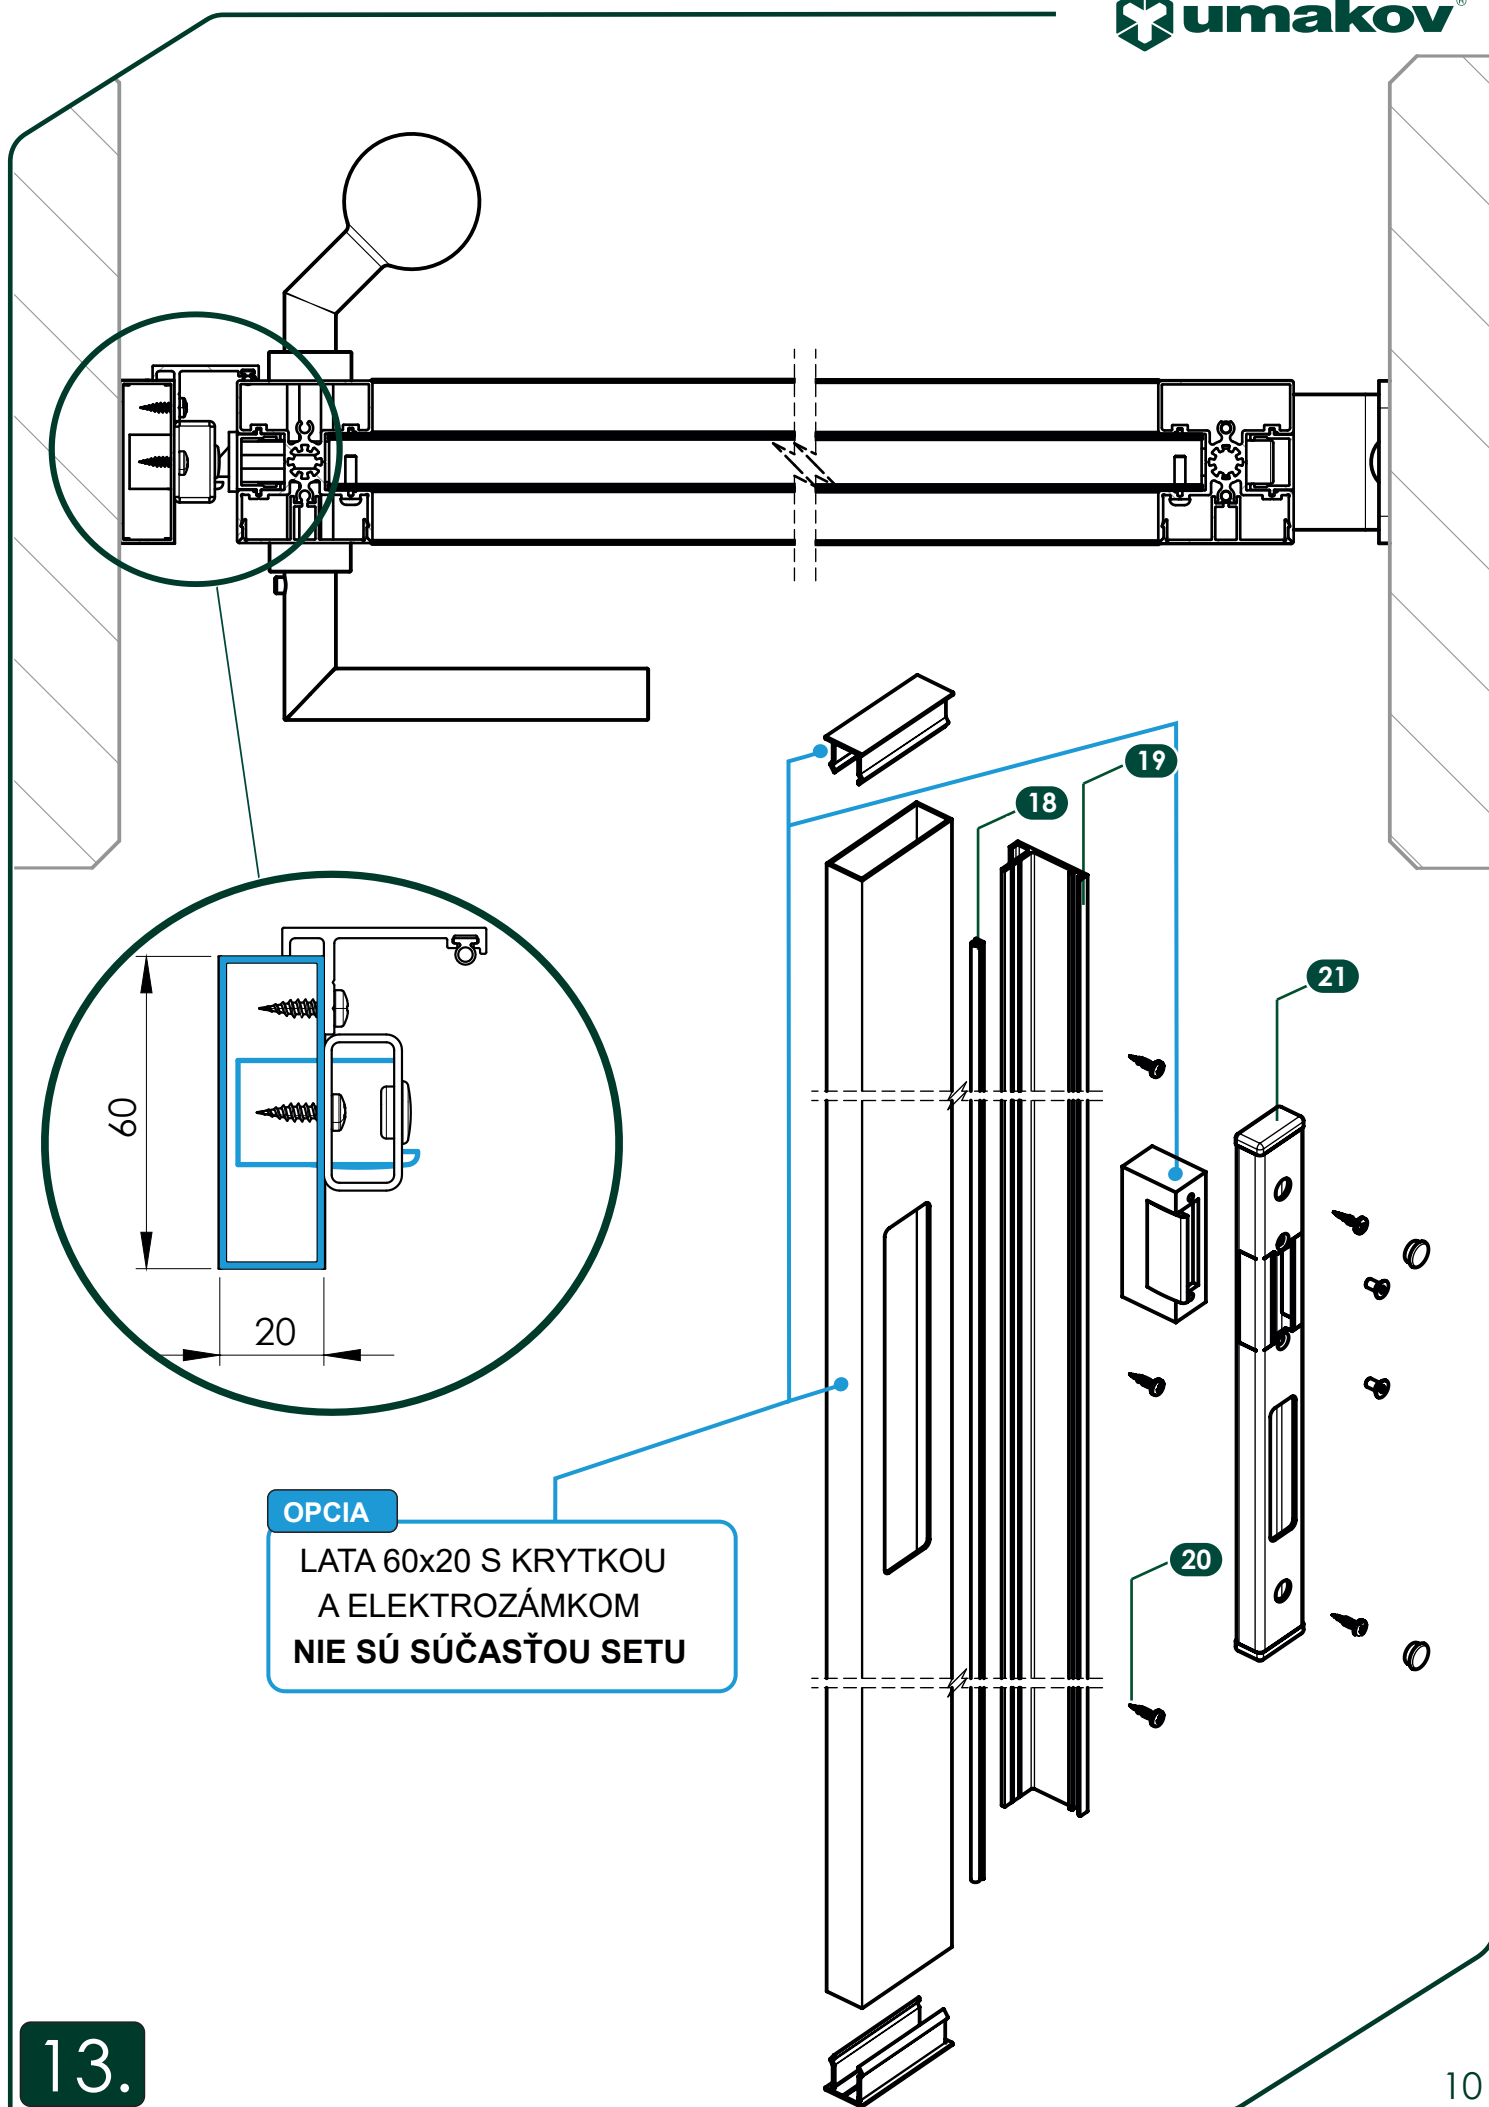


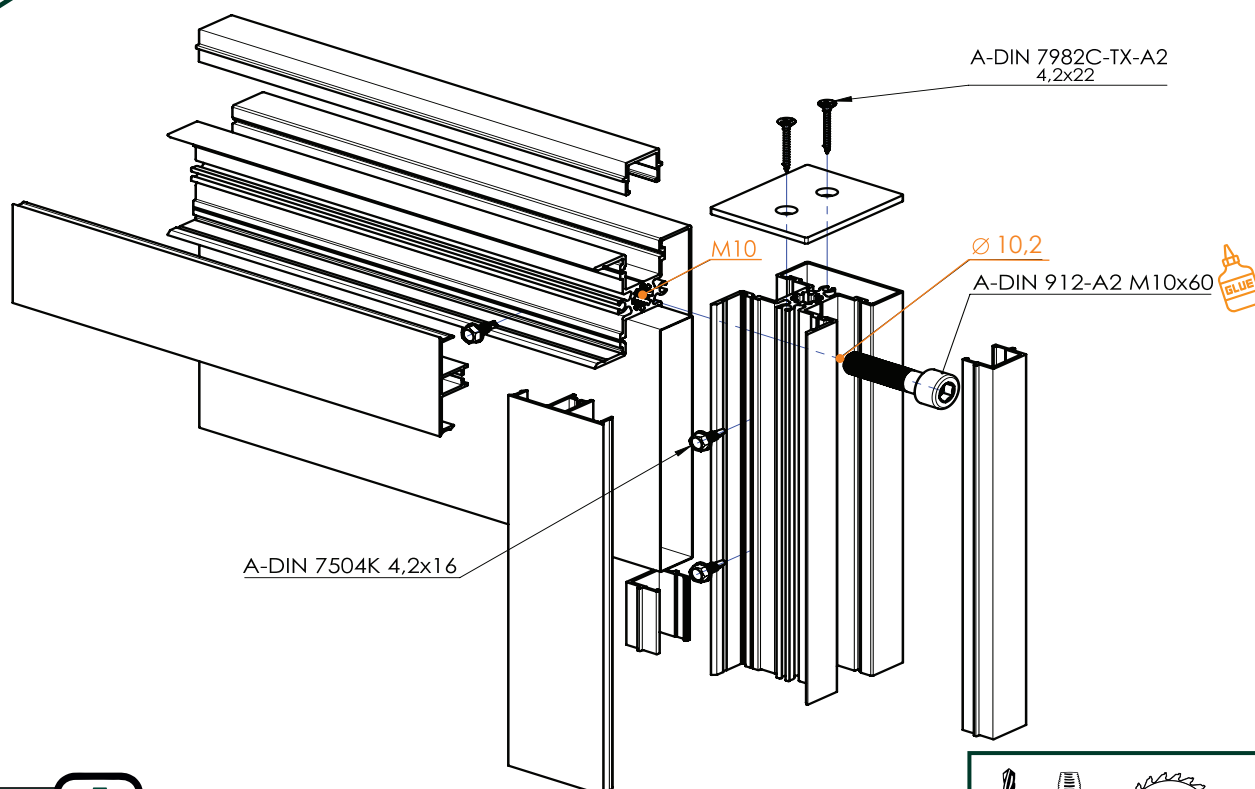

DETAIL

A

ROHOVÝ SPOJ BRÁNY - VŠEOBECNÝ

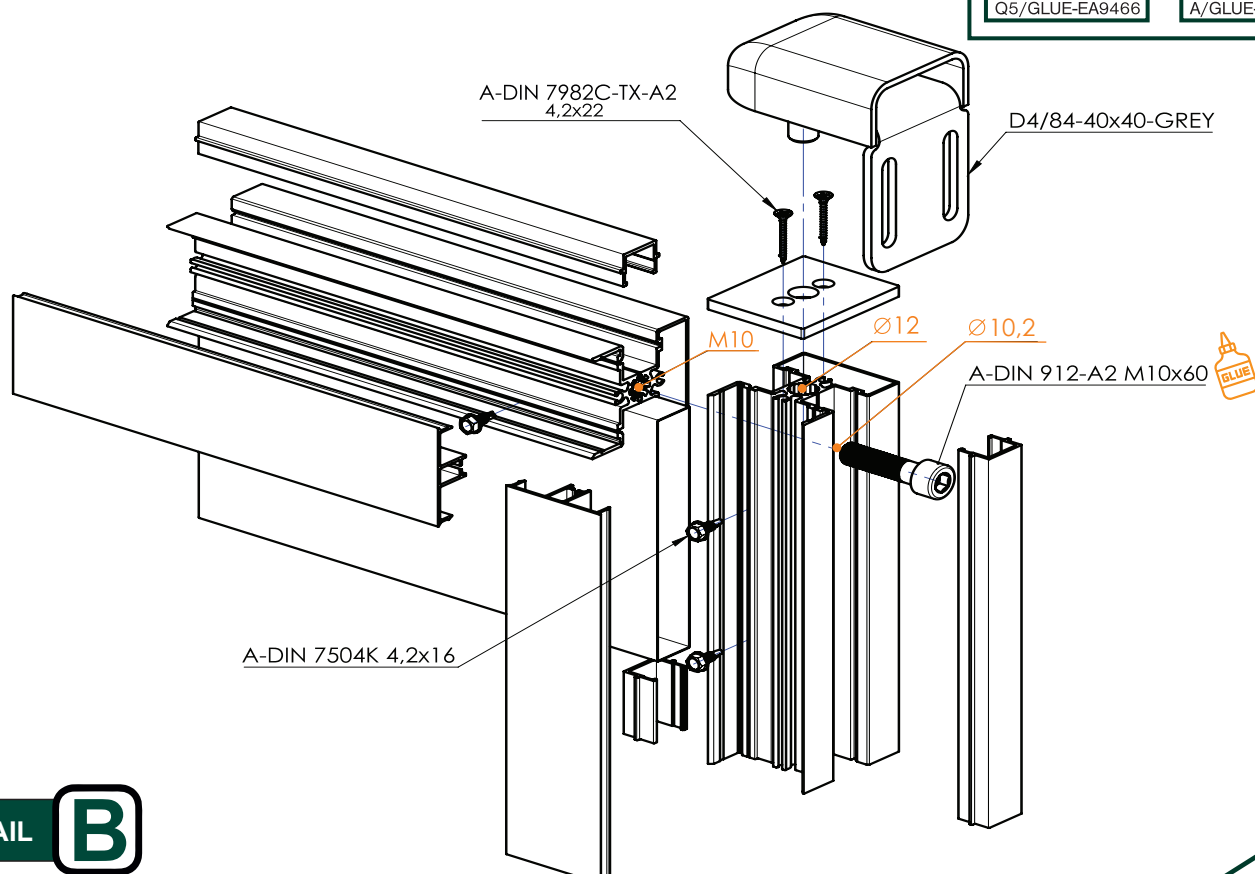

DETAIL

B

ROHOVÝ SPOJ BRÁNY - PÁNTOVÁ ČASŤ



ASSEMBLY INSTRUCTIONS

SINGLE-SWING GATE


FG/S-SSG-R7016-SET



4-6 hours




1 person

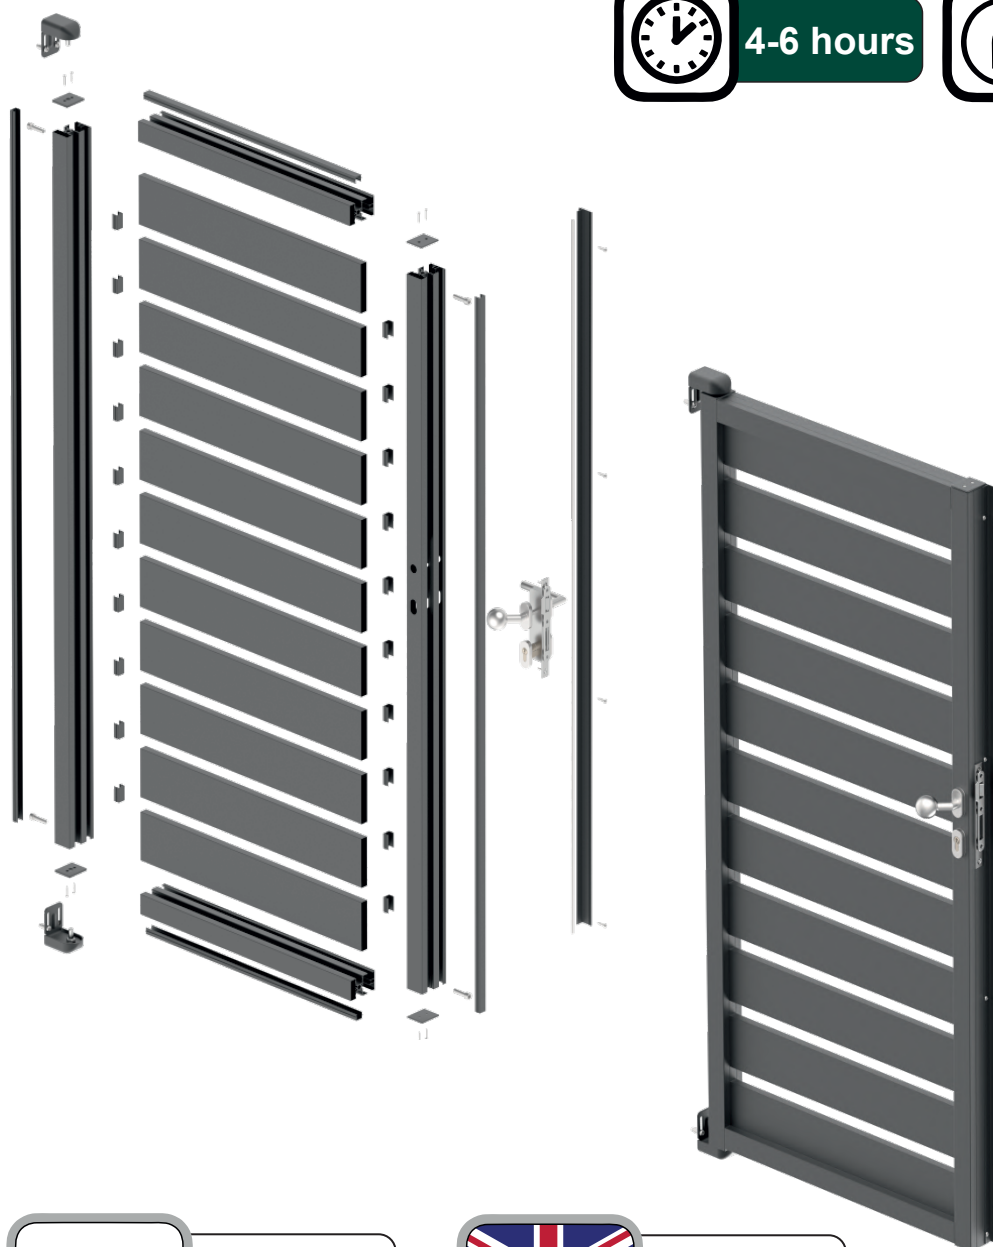


SK verzia














EN version

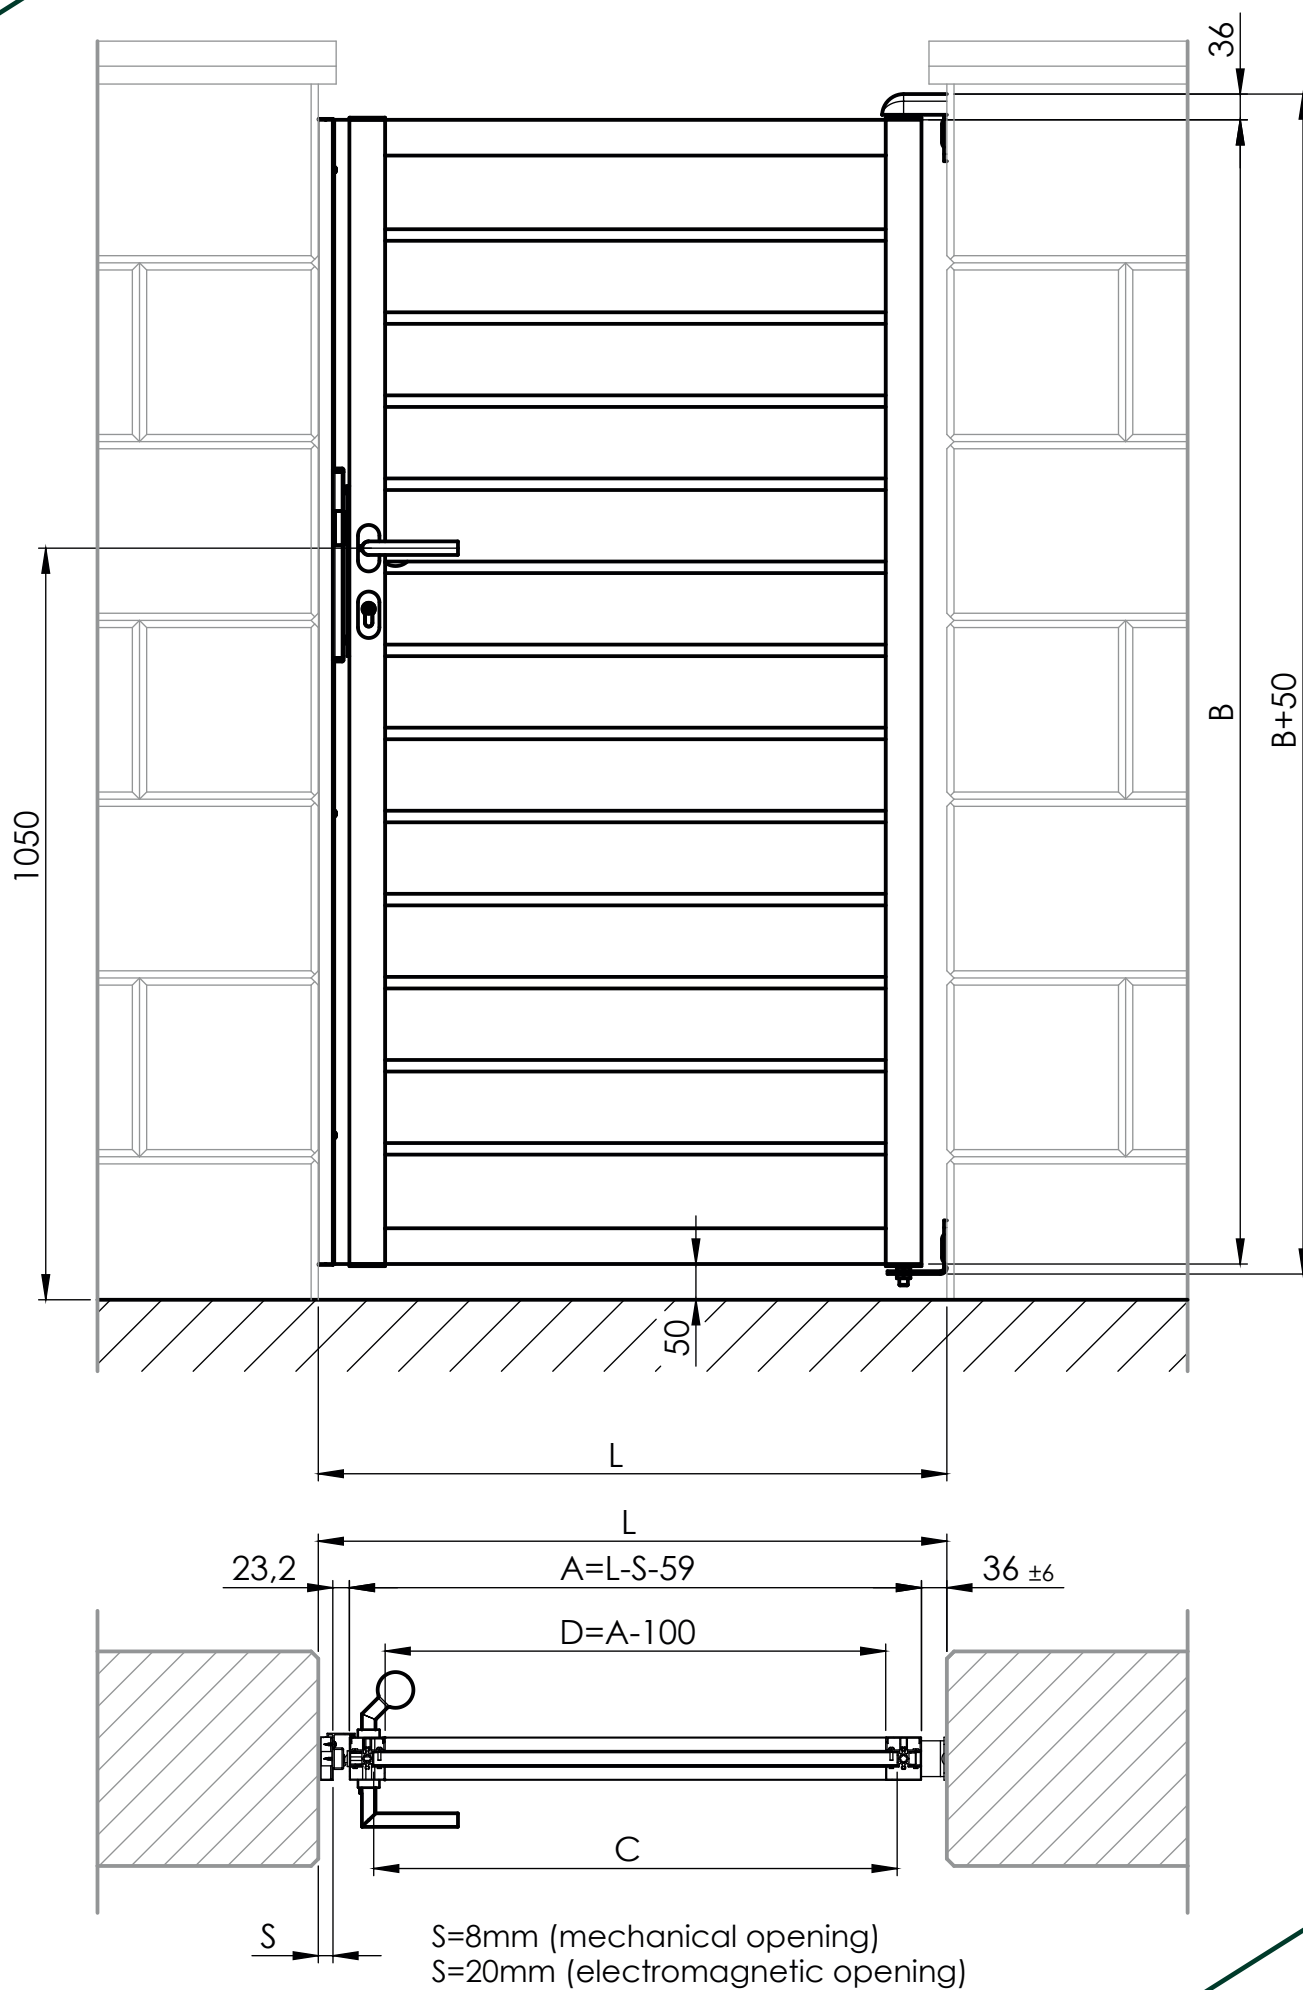

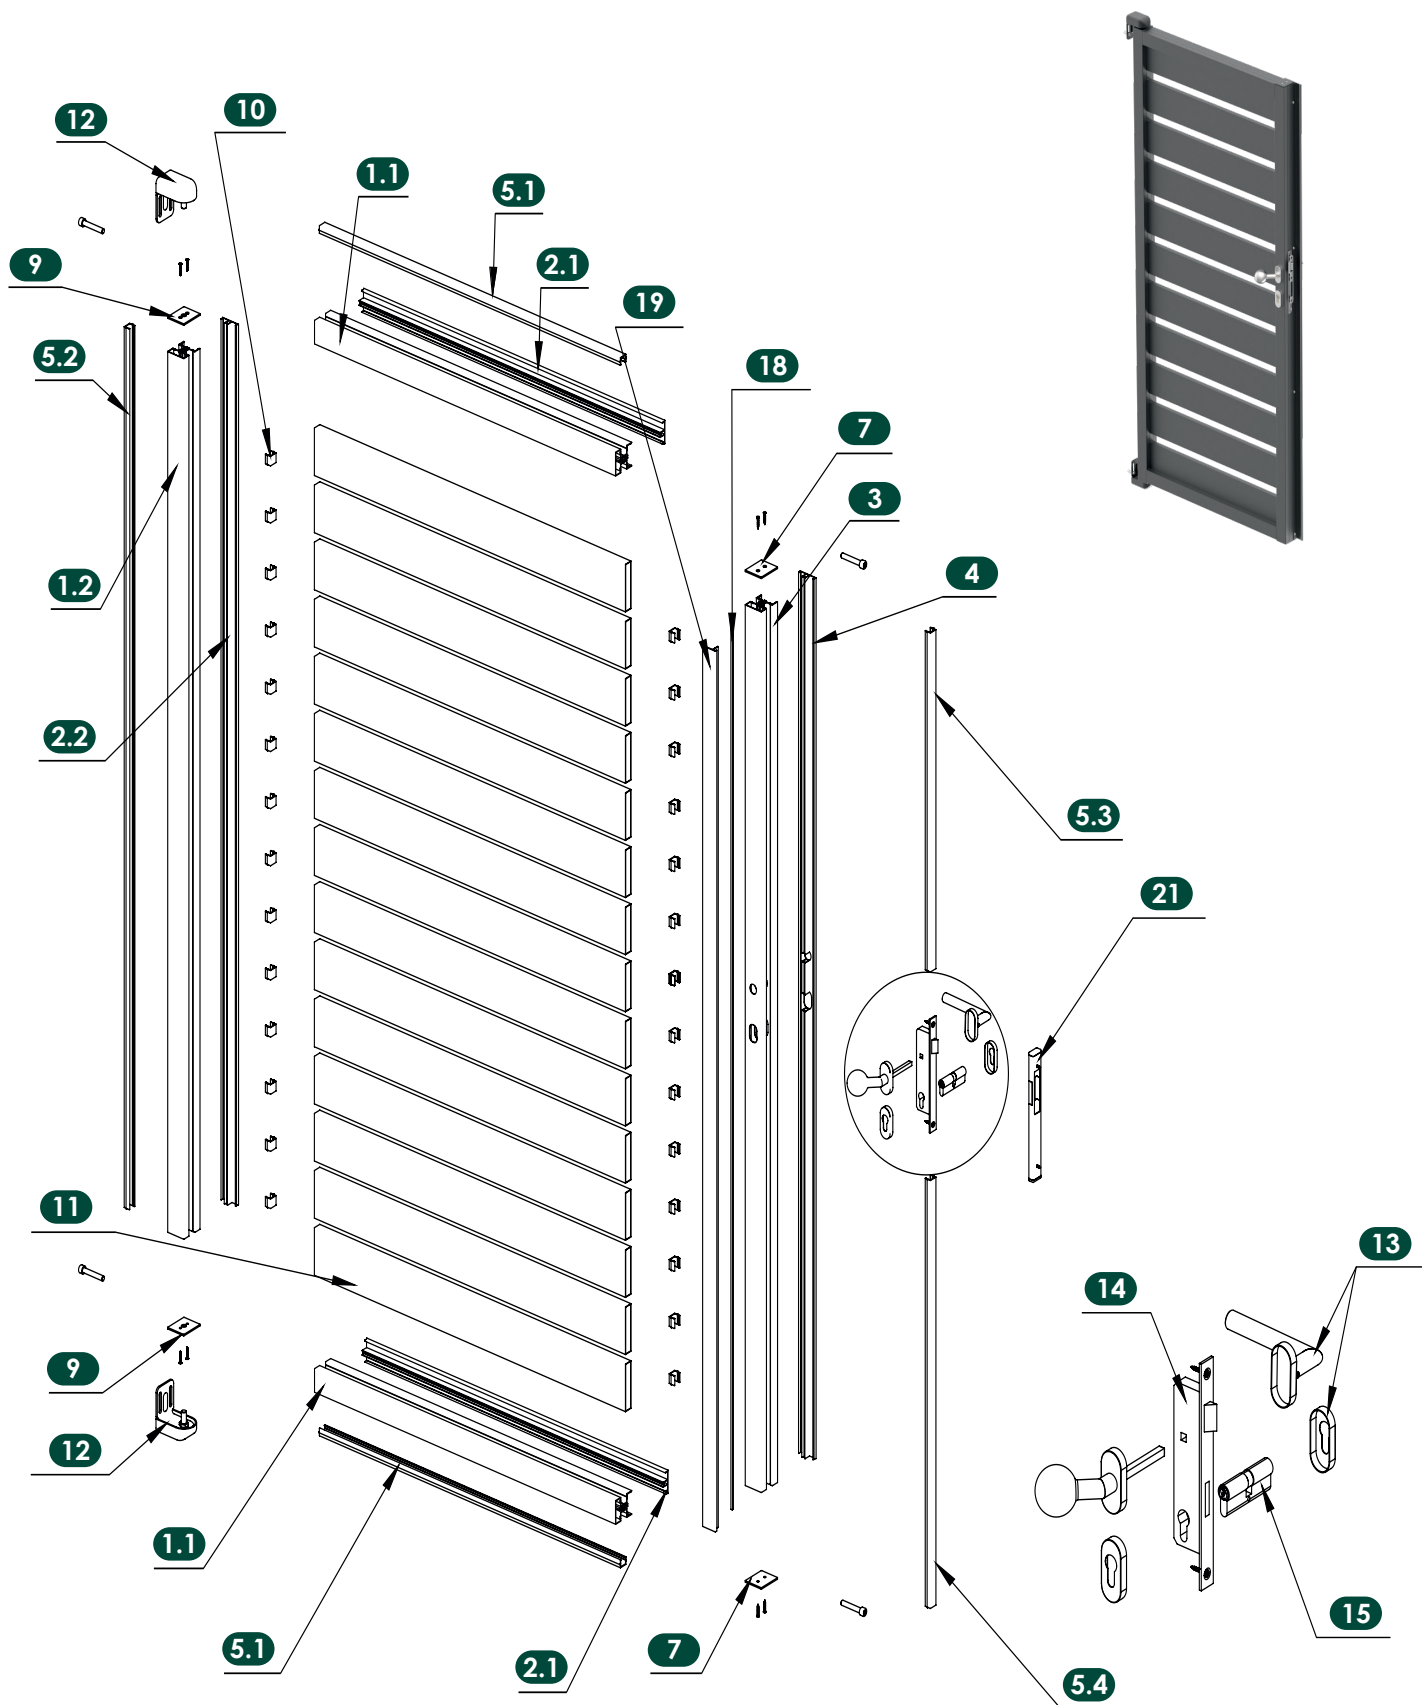

FG/S-SSG-R7016-SET


COMPONENTS

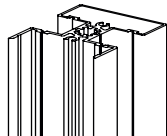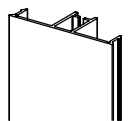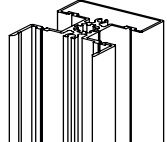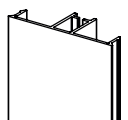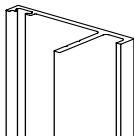

N.	LENGTH (mm)	CAT. NO.	IMAGE	QTY	N.	LENGTH (mm)	CAT. NO.	IMAGE	QTY
1.	1.1 D=A-100	FG/FP50x60-1850-R7016		2x	12.		D4/84-40x40-GREY		1x
	1.2 B (1850)								
2.	2.1 D=A-100	FG/PC49x17-1850-R7016		2x	13.		D8/05G-L-i		1 pár
	2.2 B (1850)								
3.	B (1850) MECHANISATION	FG/FP50x60M-1850-R7016		1x	14.		B1/30-25x90		1x
4.	B (1850) MECHANISATION	FG/PC49x17M-1850-R7016		1x	15.		B1/19N-80		1x
5.	5.1 D=A-100	FG/PC20x16-1850-R7016		3x	16.		A-DIN 7505A 5x35		2x
	5.2 B (1850)								
	5.3 B-1064								
	5.4 874								
6.		A-DIN 912-A2 M10x60		4x	17.		A-DIN 7504K-A2 4,2x16		60x
7.		FG/CP50x60-R7016		2x	18.	B (1850)	A19/4466-M		2m
8.		A-DIN 7505A 5x20		8x	19.	B (1850)	FG/DS40x20-2000-R7016		1x
9.		FG/CH50x60-R7016		2x	20.		A-PH 5x20		5x
10.	20	FG/PC20x16-20-R7016		28x	21.		B8/07T-30x15		1x
11.	C=A-68 (15pcs)	FG/S20x100x1-3000-R7016		5x					

SAW CUTTING


1.1
2x

2.1
2x

5.1
2x

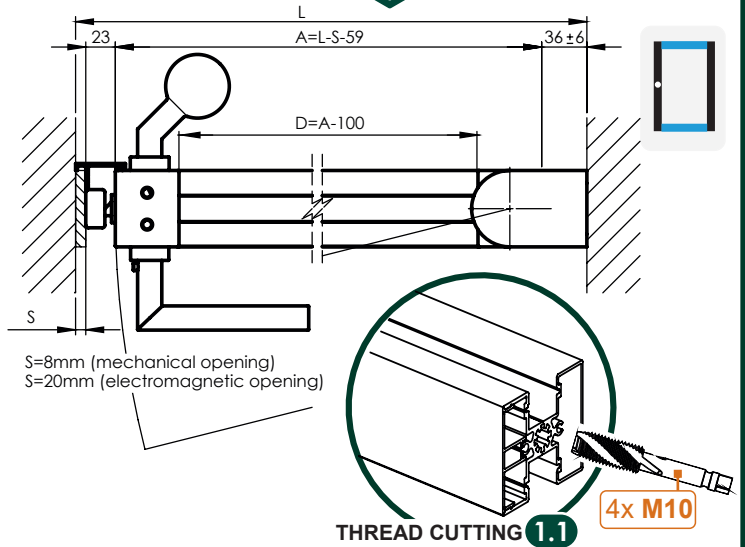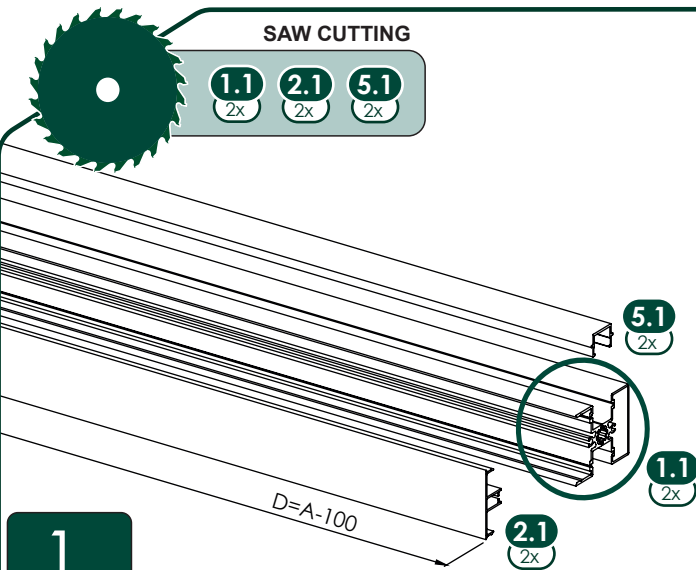

1.

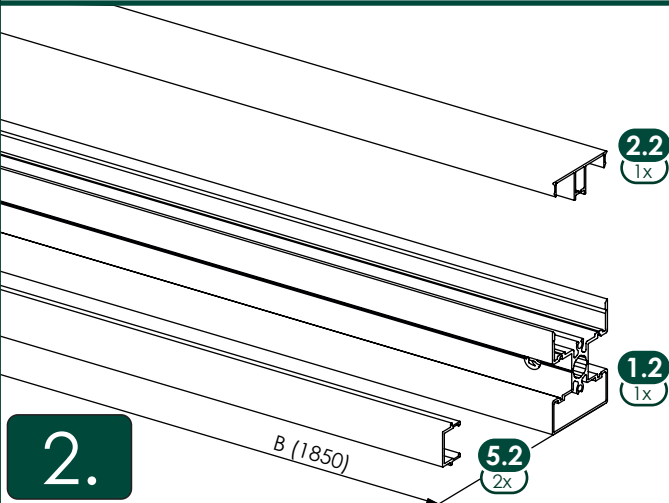



2.

2x Ø 10,2 mm

FOR CONNECTING THE FRAME PROFILES

2x Ø 12 mm



HINGE HOLE ENLARGEMENT

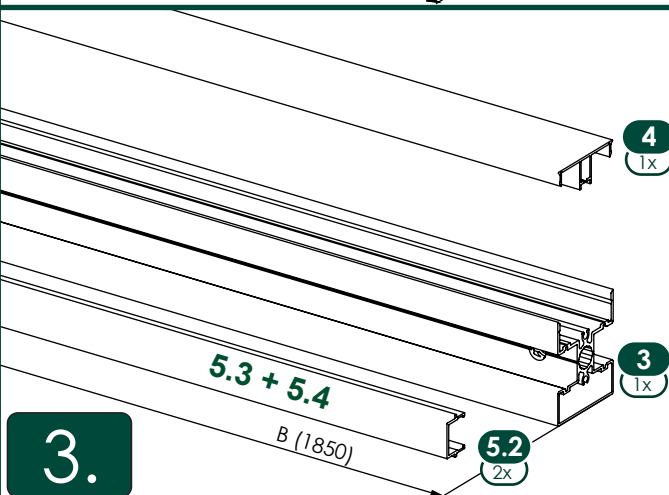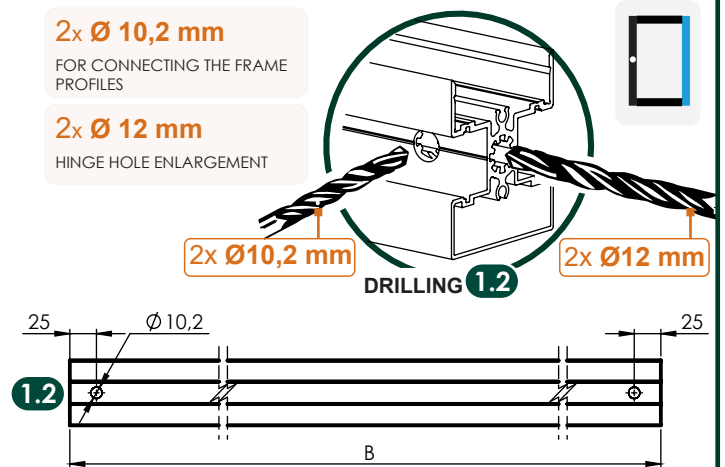

3.

2x Ø 10,2 mm


FOR CONNECTING THE FRAME PROFILES

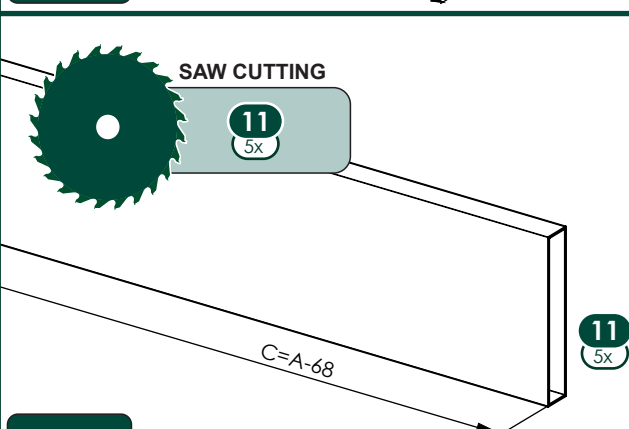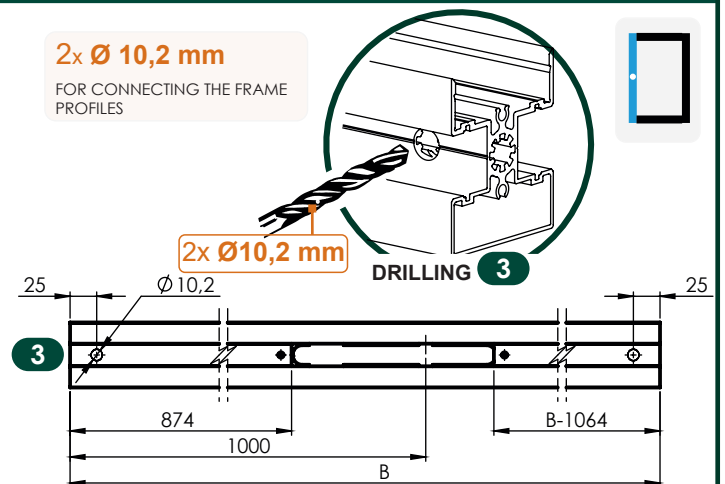

4.


SAW CUTTING

11
5x

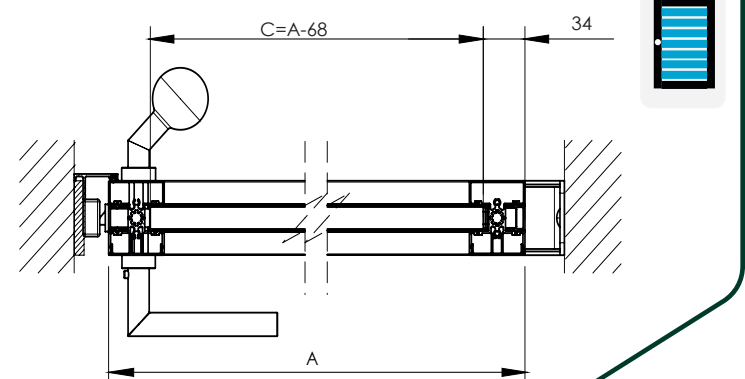


LEFT GATE

RIGHT GATE

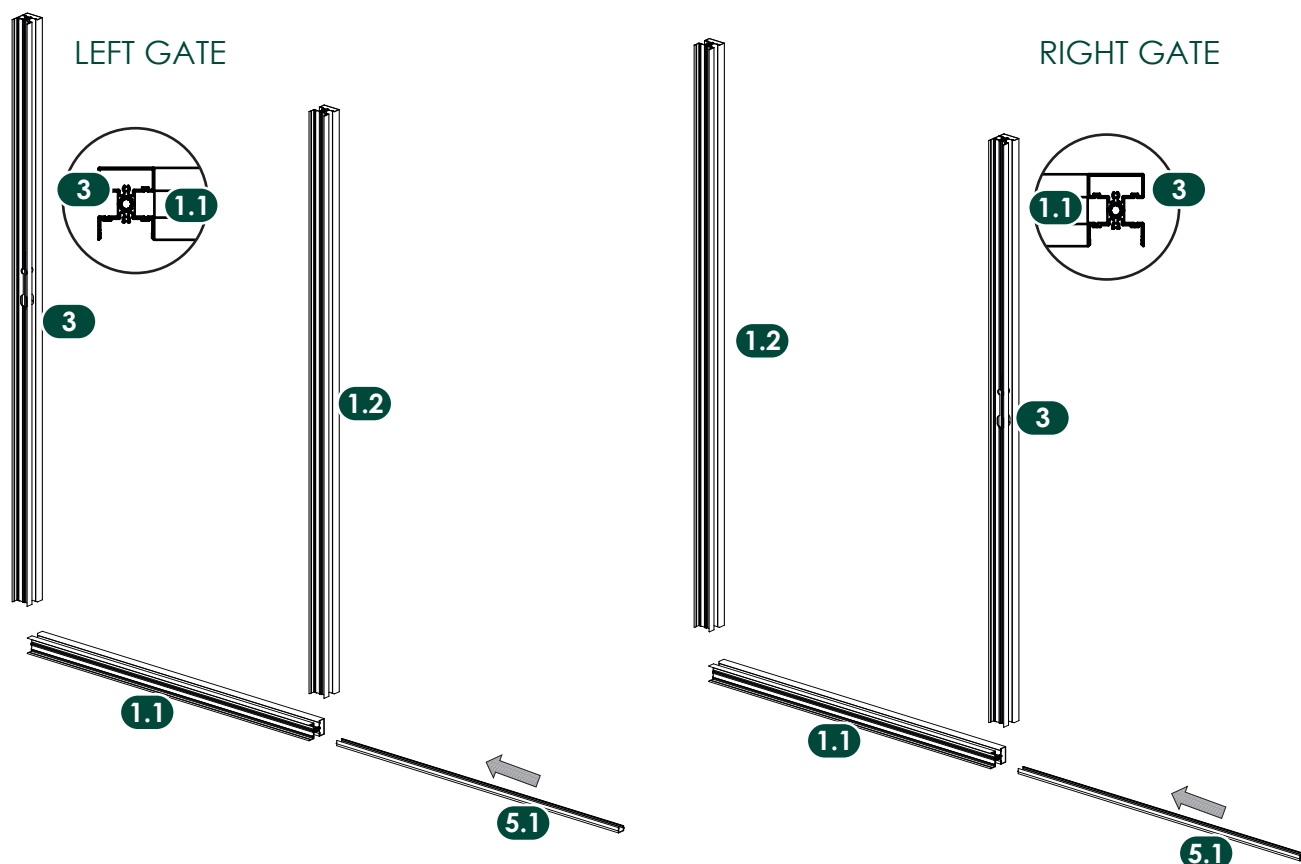

5.

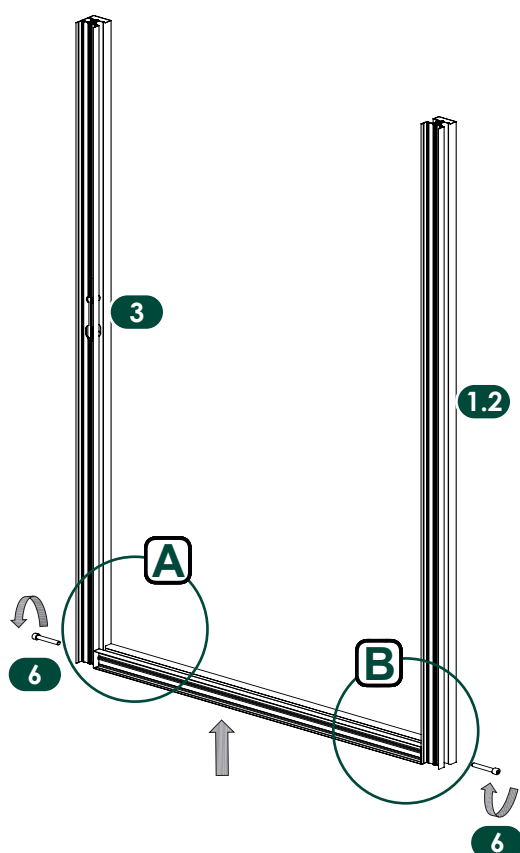

6.


DETAIL

A


DETAIL

B


page
11

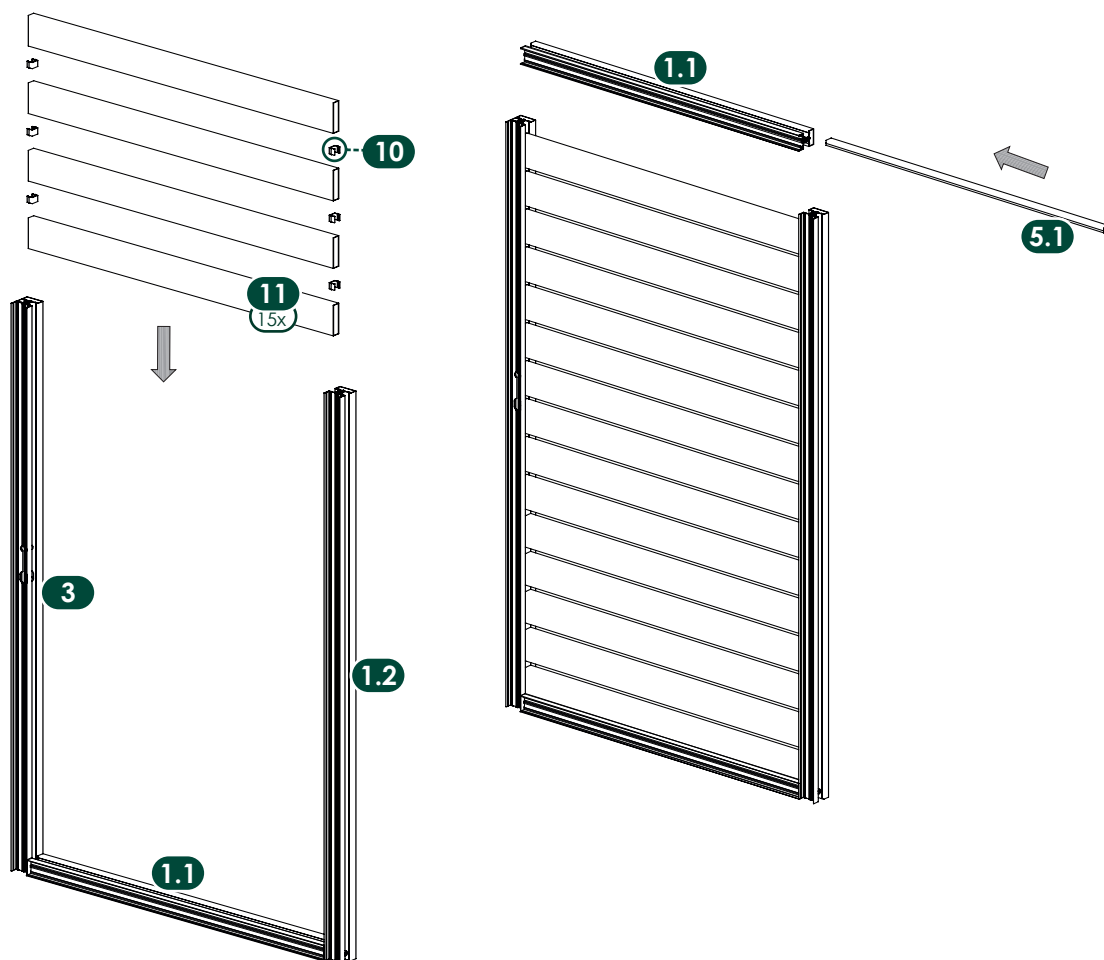

7.

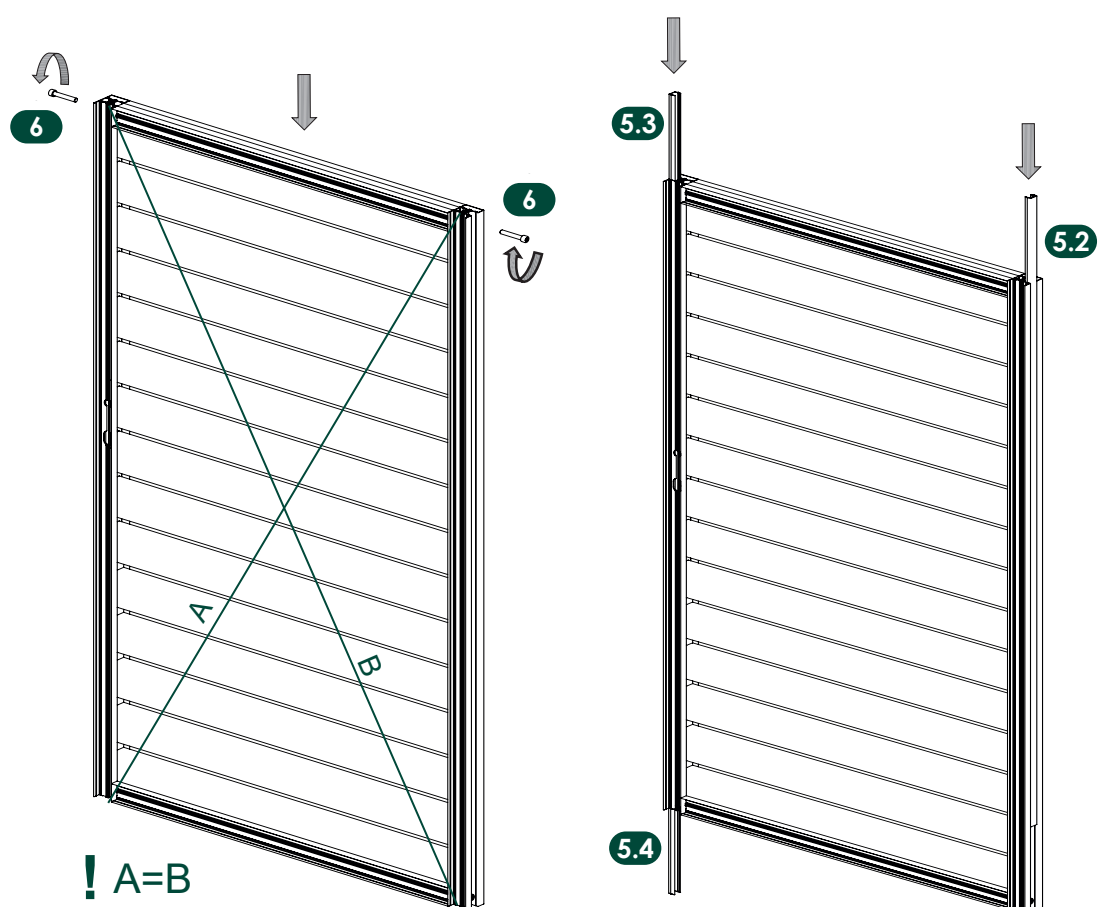

8.

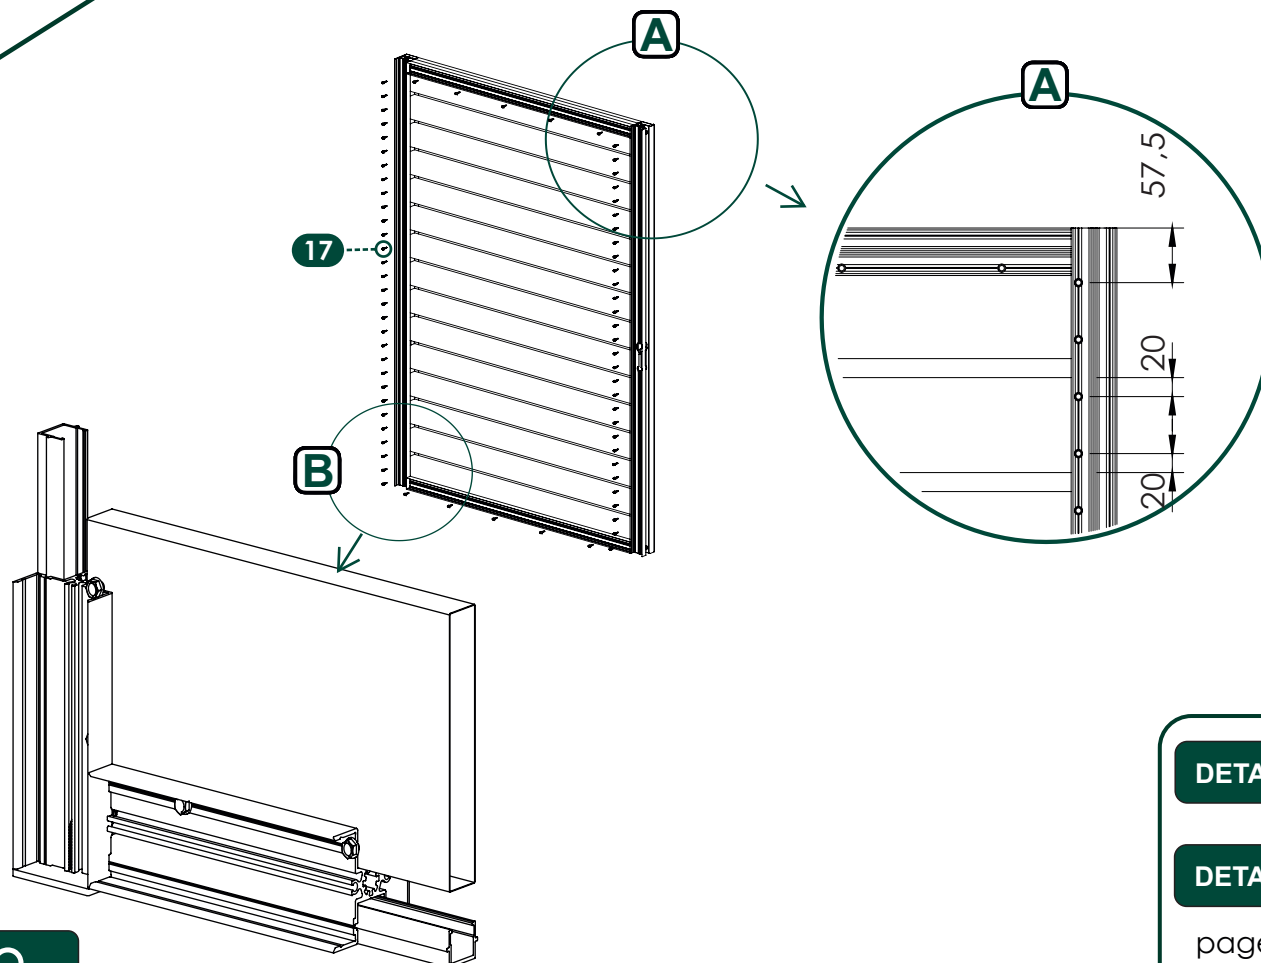

9.


DETAIL

A


DETAIL

B


page
11

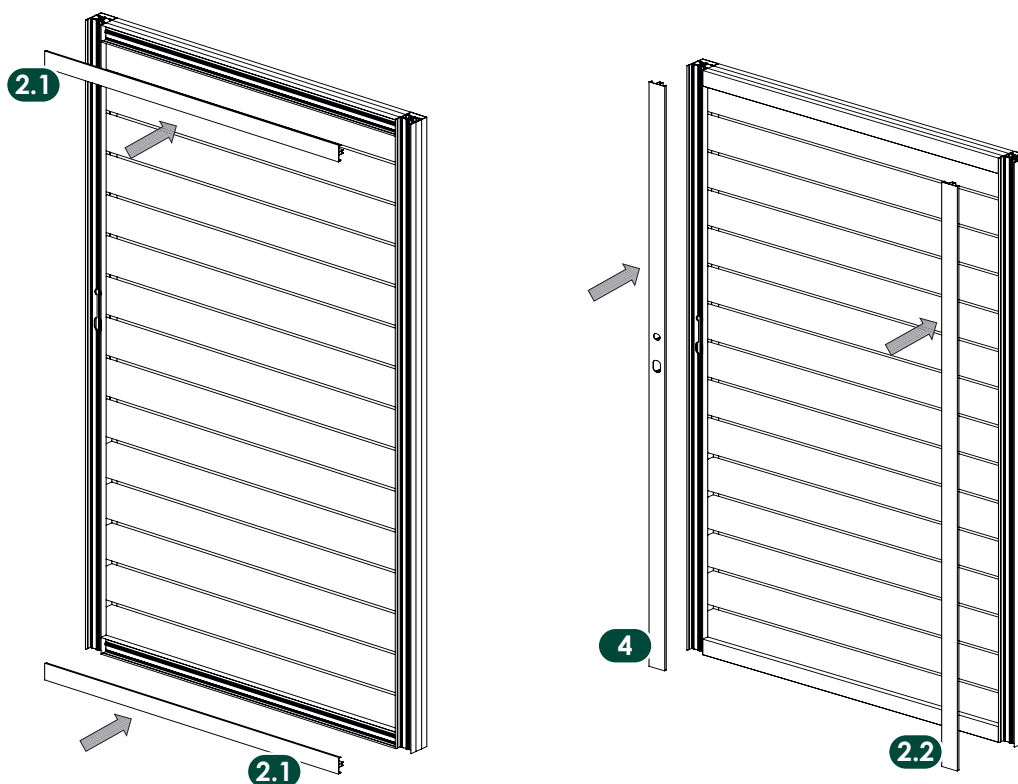


10.

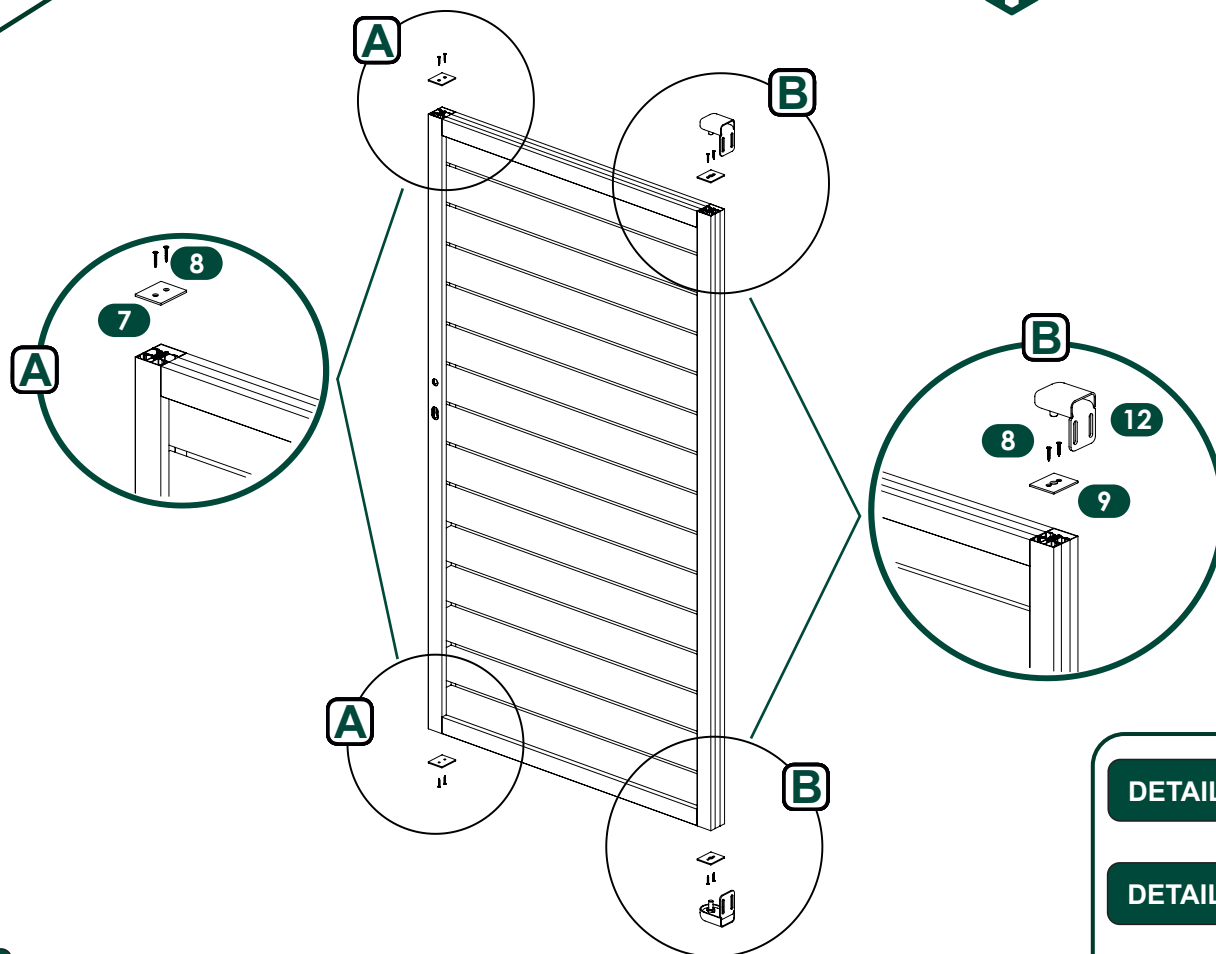


11.

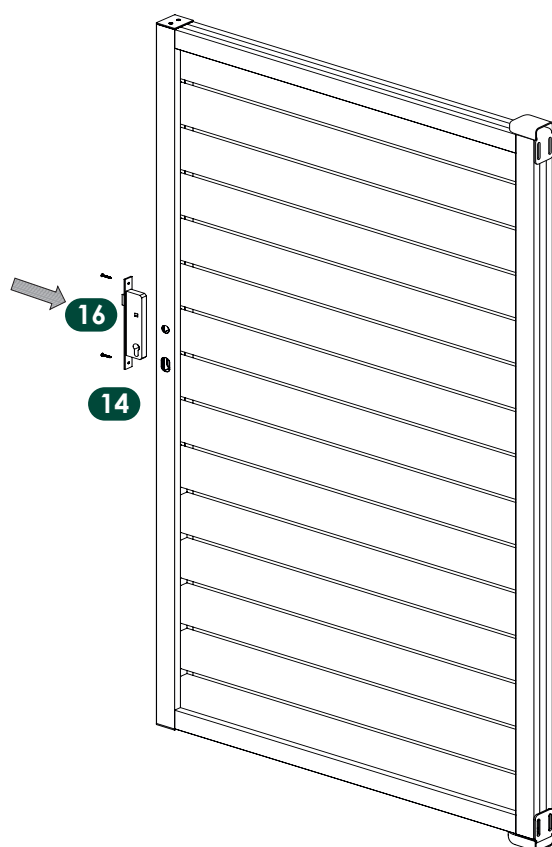

12.


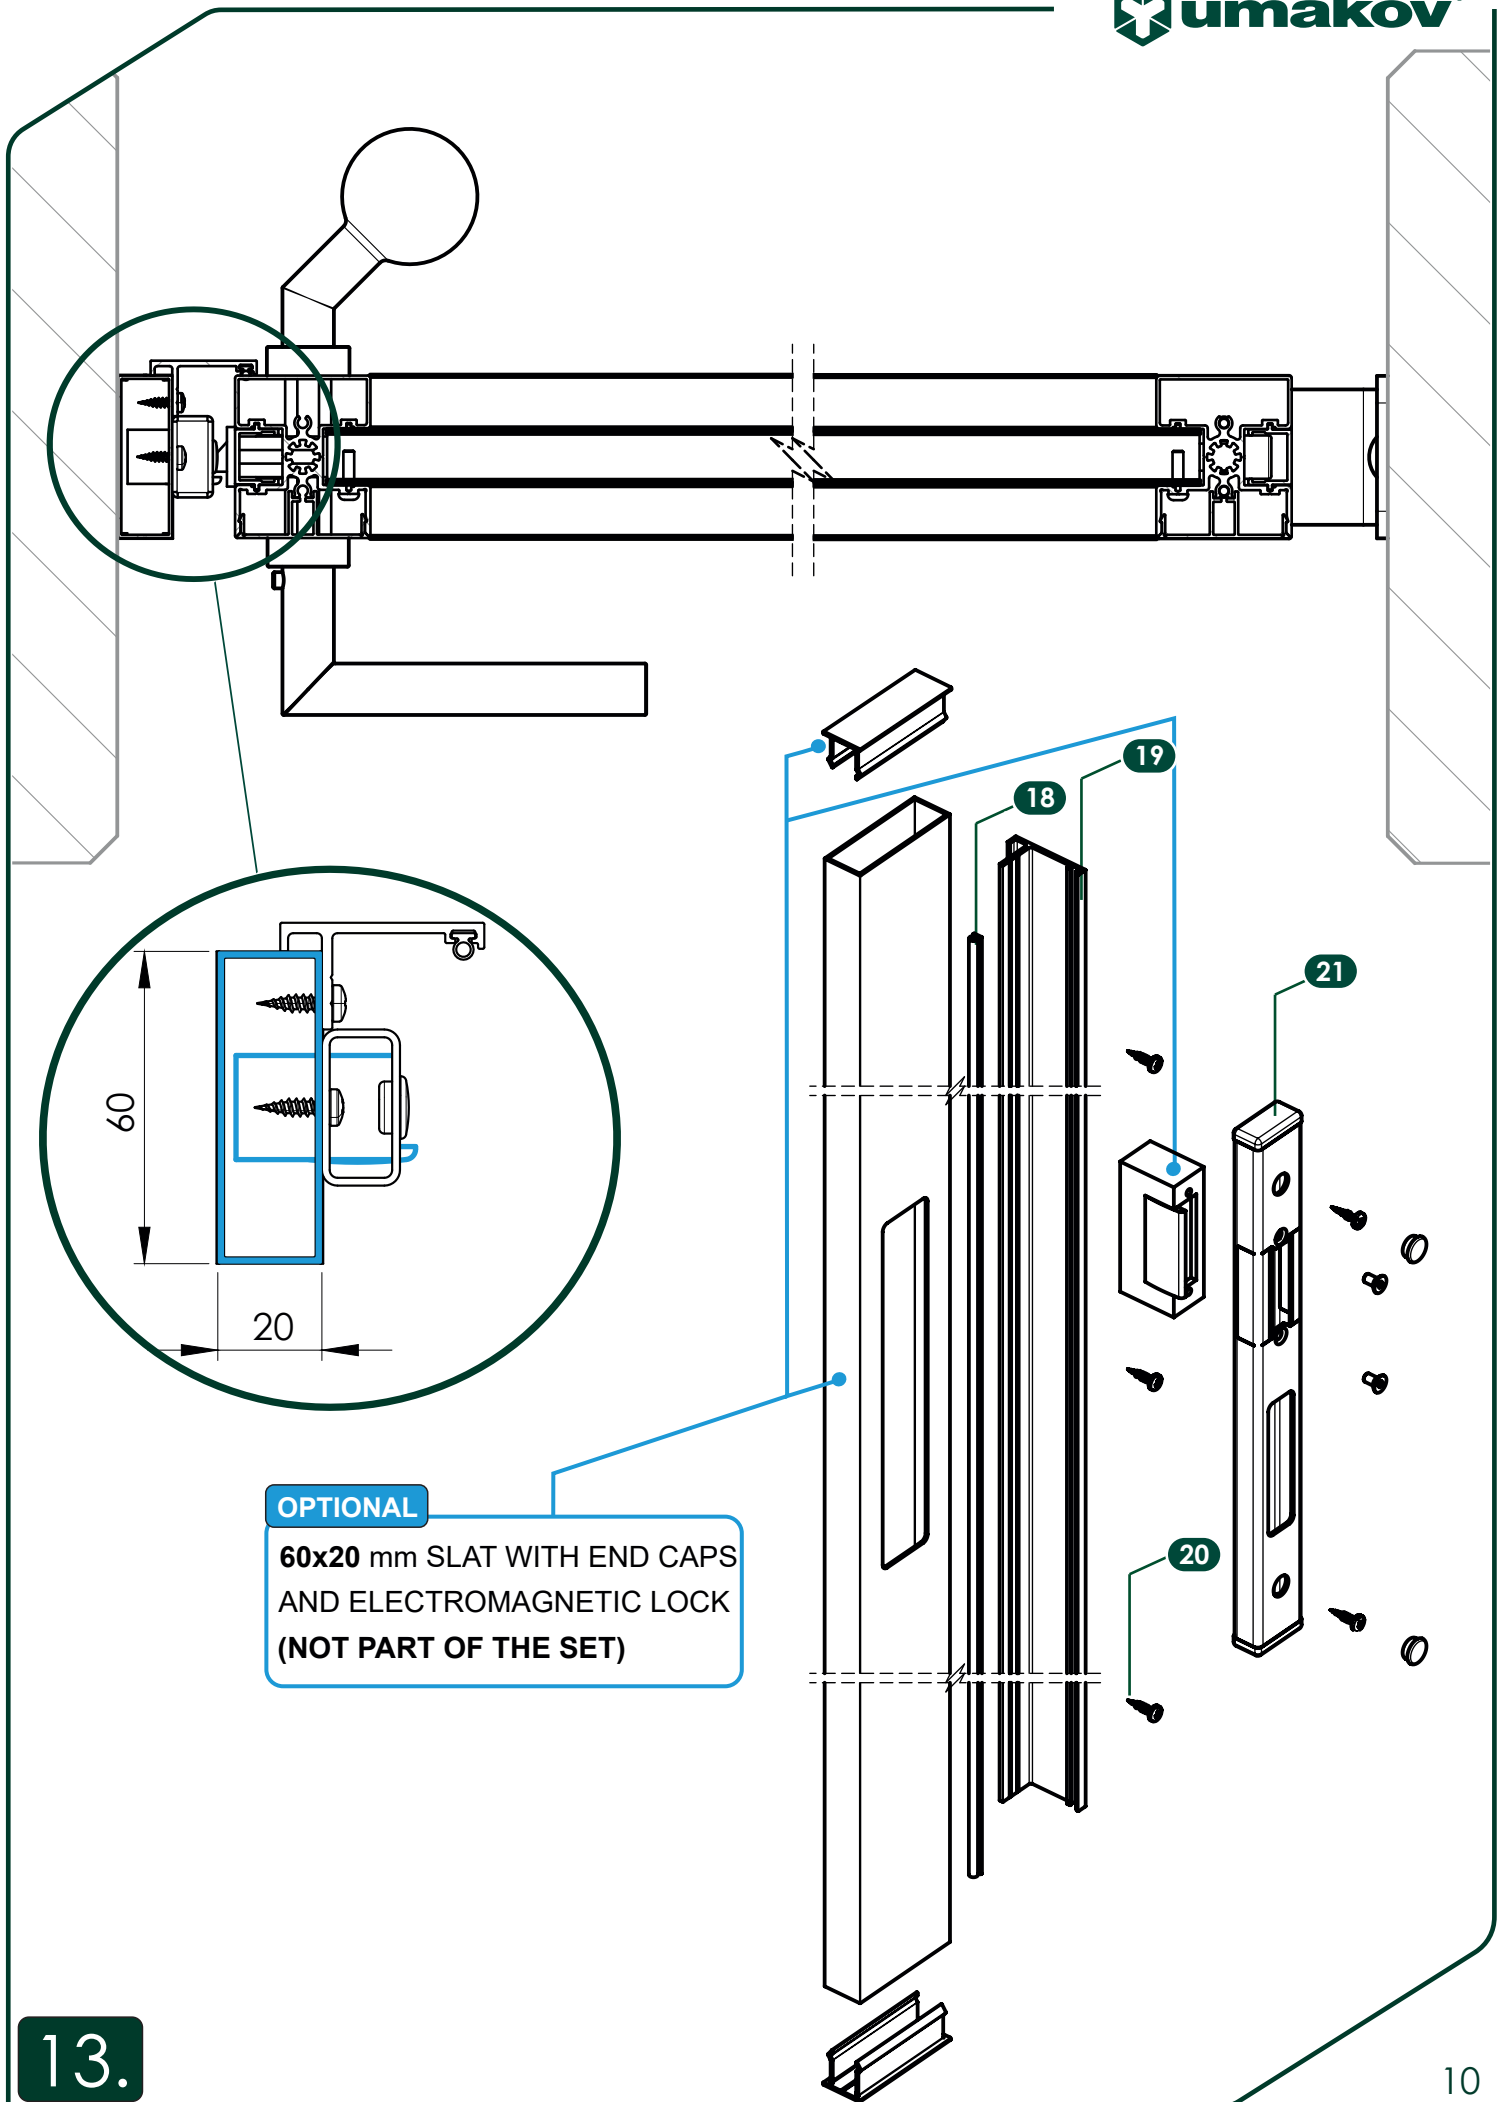


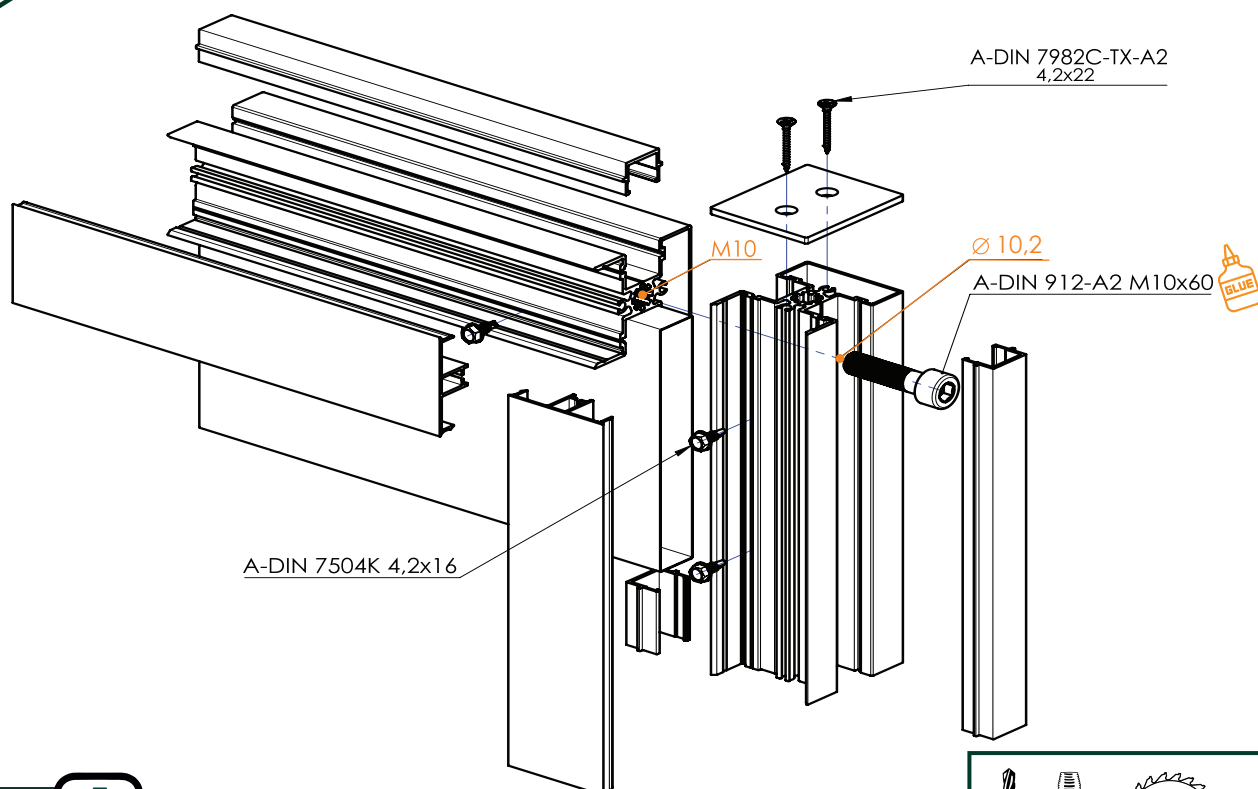

DETAIL

A

CORNER JOINT OF THE GATE (GENERAL)

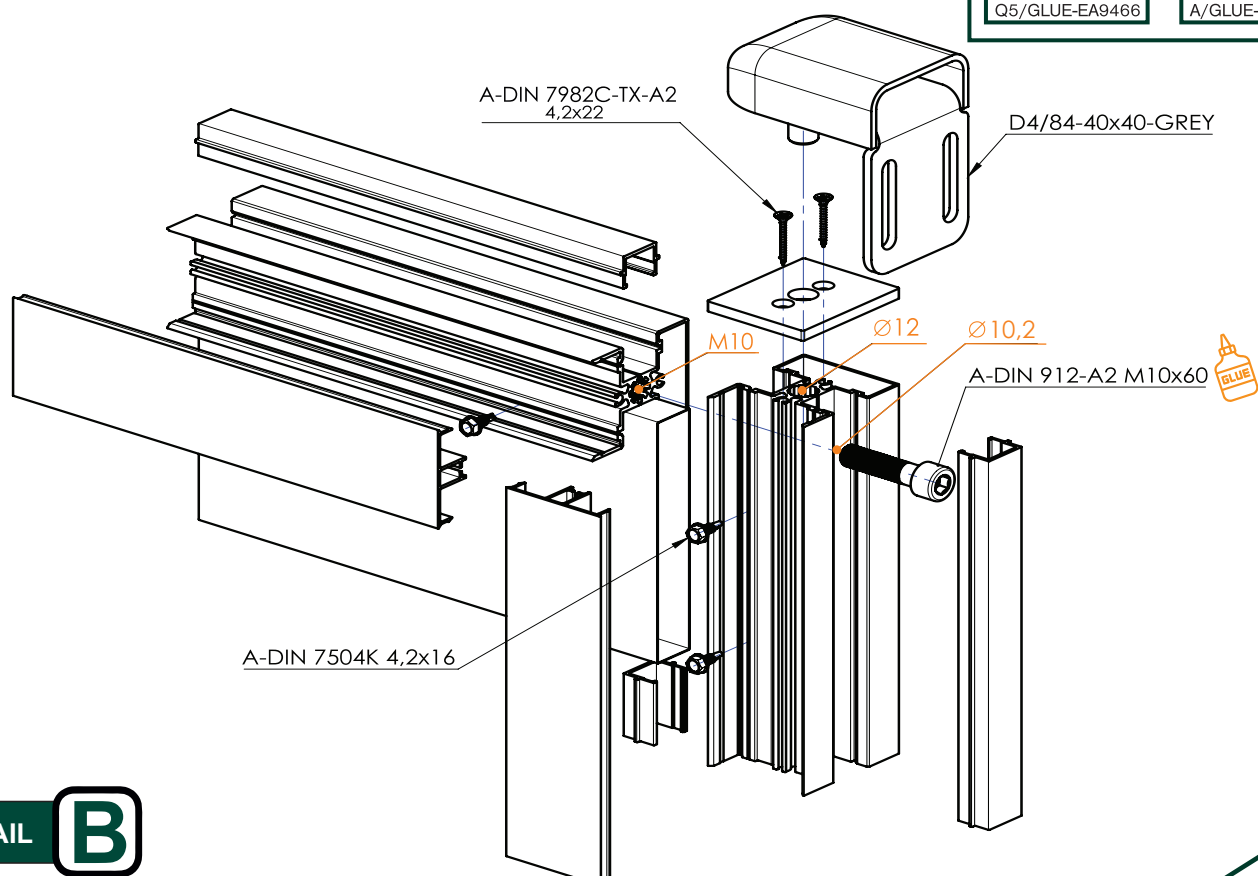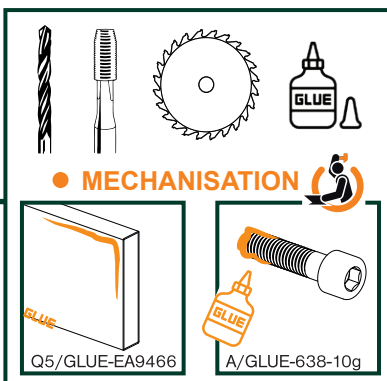

DETAIL

B

CORNER JOINT OF THE GATE (HINGE PART)