



MONTÁŽNY NÁVOD DVOJKRÍDLOVÁ BRÁNA FG/S-DSG-R7016-SET



6-8 hodín





1 osoba




SK verzia













EN version soon

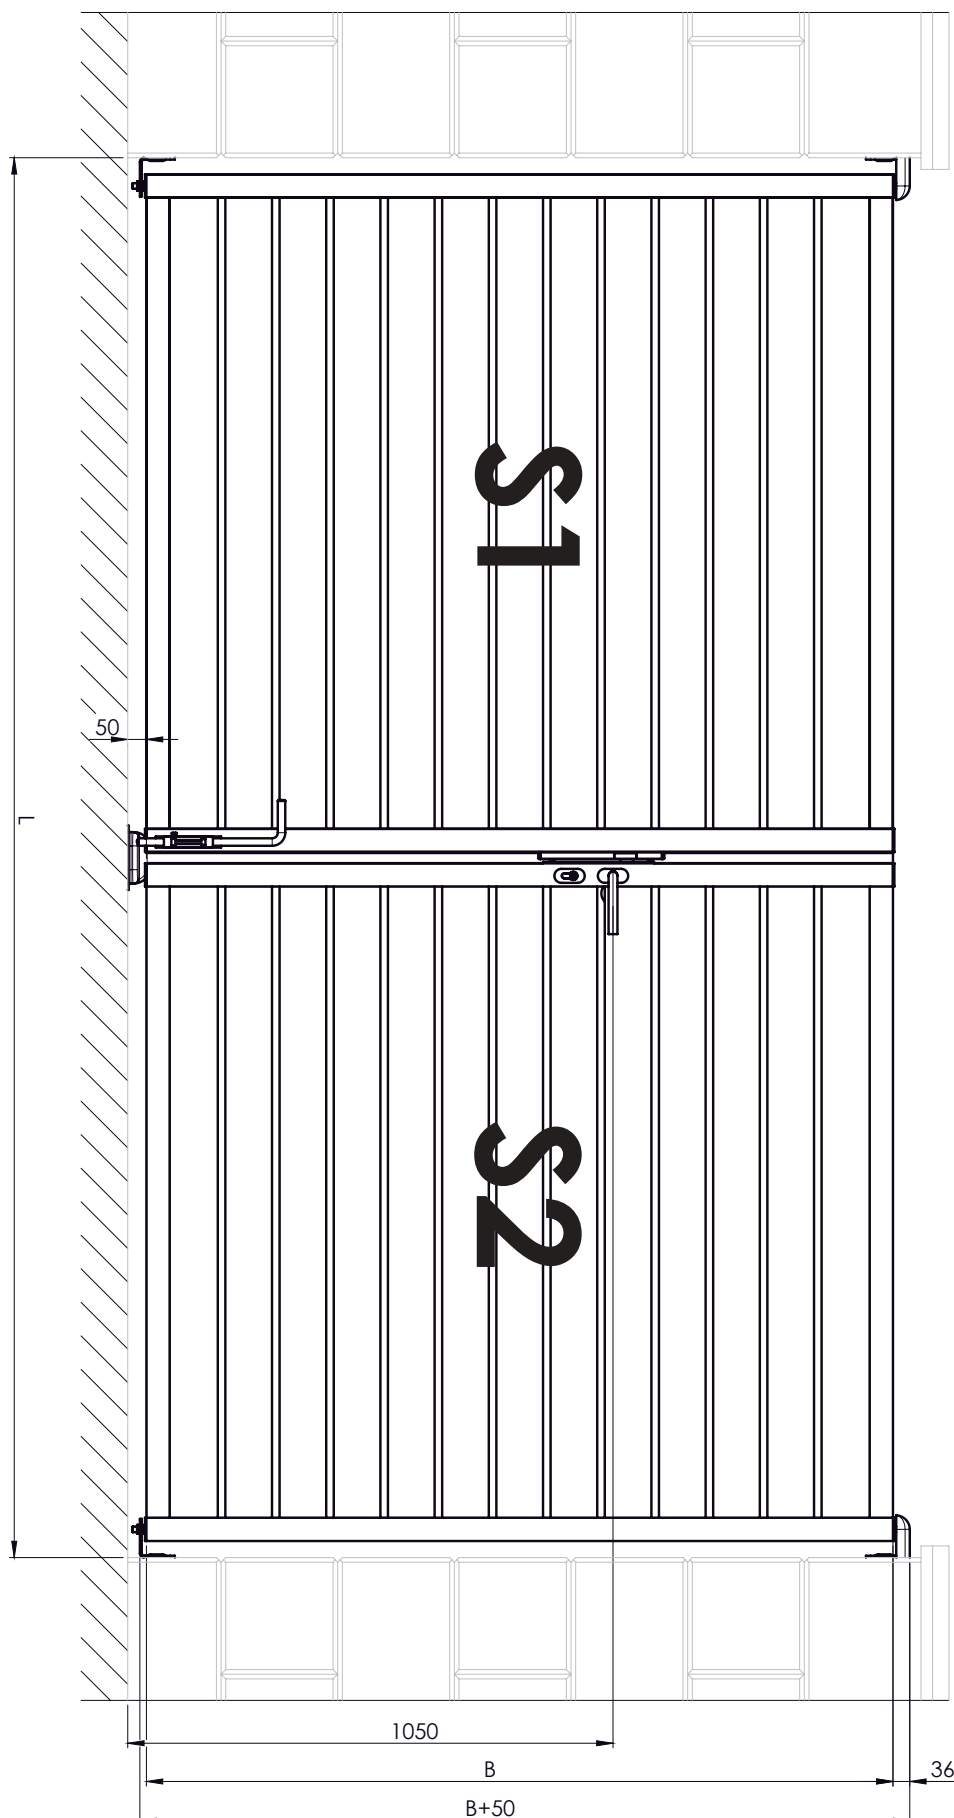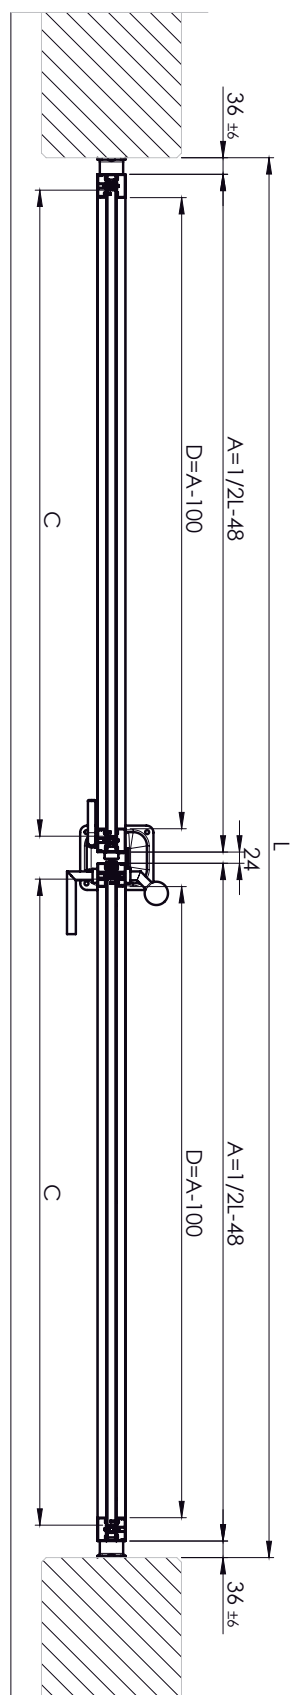

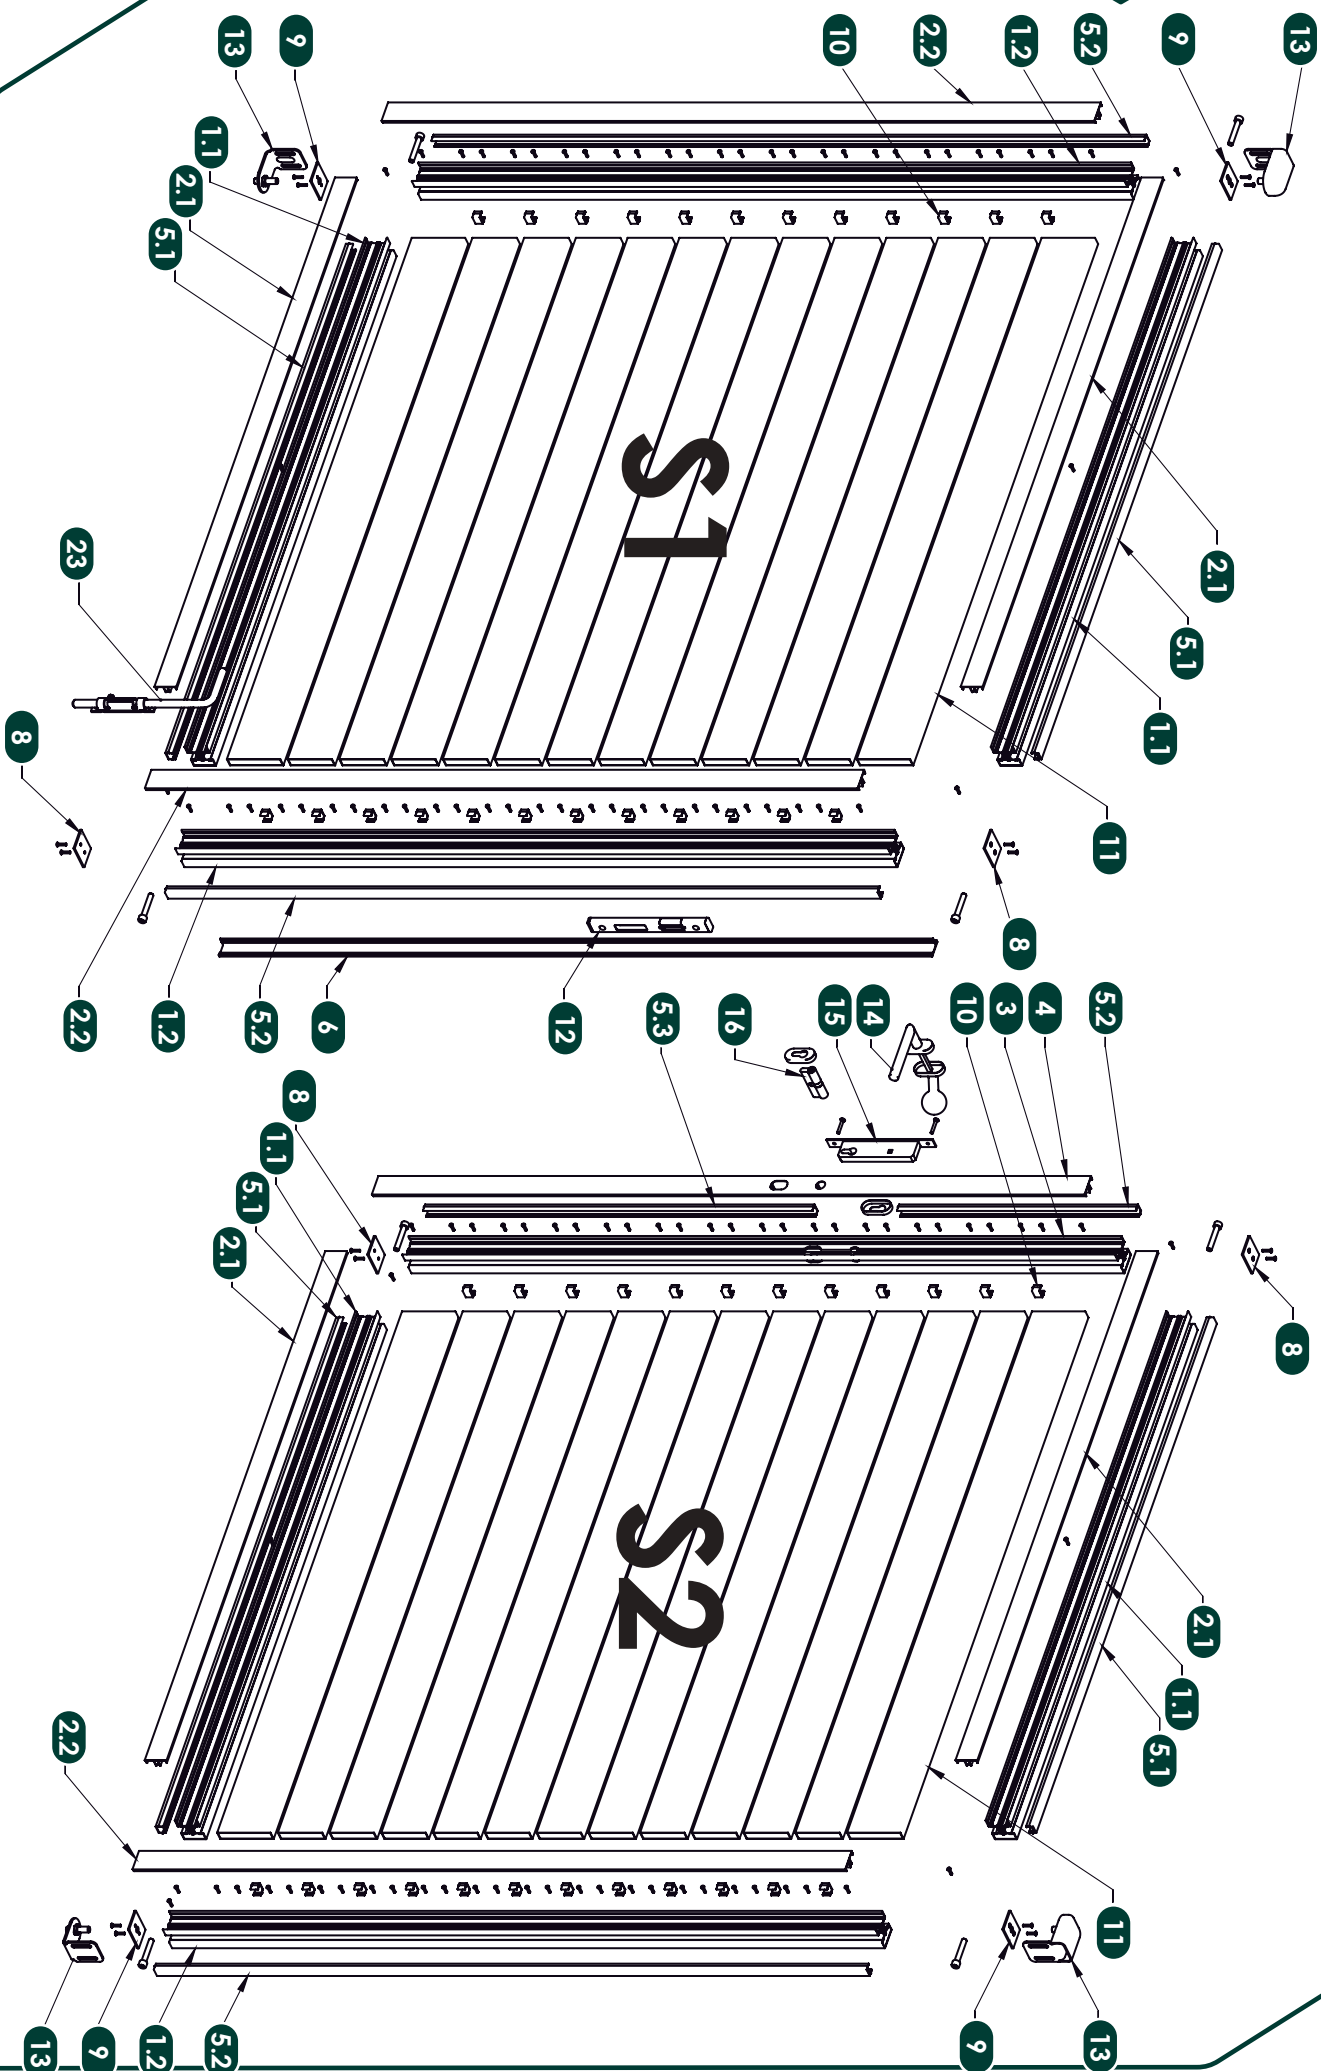



KOMPONENTY

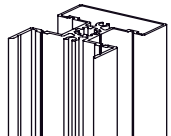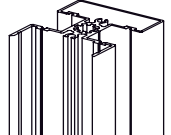N.	DĹŽKA (mm)	KAT. Č.	OBRÁZOK	QTY	N.	DĹŽKA (mm)	KAT. Č.	OBRÁZOK	QTY
1.	1.1 D=A-100	FG/FP50x60-1850-R7016		4x	13.		D4/84-40x40-BLACK		2x
	1.2 B (1850)			3x					
2.	2.1 D=A-100	FG/PC49x17-1850-R7016		4x	14.		D8/05G-L-i		1 pár
	2.2 B (1850)			3x					
3.	B (1850) MECHANIZÁCIA	FG/FP50x60M-1850-R7016		1x	15.		B1/30-25x90		1x
4.	B (1850) MECHANIZÁCIA	FG/PC49x17M-1850-R7016		1x	16.		B1/19N-80		1x
5.	5.1 D=A-100	FG/PC20x16-1850-R7016		4x	17.		A-DIN 7505A 5x35		2x
	5.2 B (1850)			3x					
	5.3 B-1064			1x	18.		A-DIN 7982C-TX-A2 4,2x22		16x
	5.4 874								
6.	B (1850)	FG/DS40x20-2000-R7016		1x	19.		A-DIN 7504K-A2 4,2x16		120 x
7.	B (1850)	A19/4466-M		4x	20.		A-DIN 7505A 5x45		4x
8.		FG/CP50x60-R7016		4x	21.		A-DIN 912-A2 M10x60		8x
9.		FG/CH50x60-R7016		4x	22.		A-PH 5x20		7x
10.	20	FG/PC20x16-20-R7016		56x	23.		D8/12-300		1x
11.	C=A-68	FG/S20x100x1,1-2000-R7016		30x	24.		B8/32		1x
12.		B8/07T-30x15		1x					

S1

1.2

1.2

1.1

5.1

5.

S2


3

1.2

1.1

5.1

6.

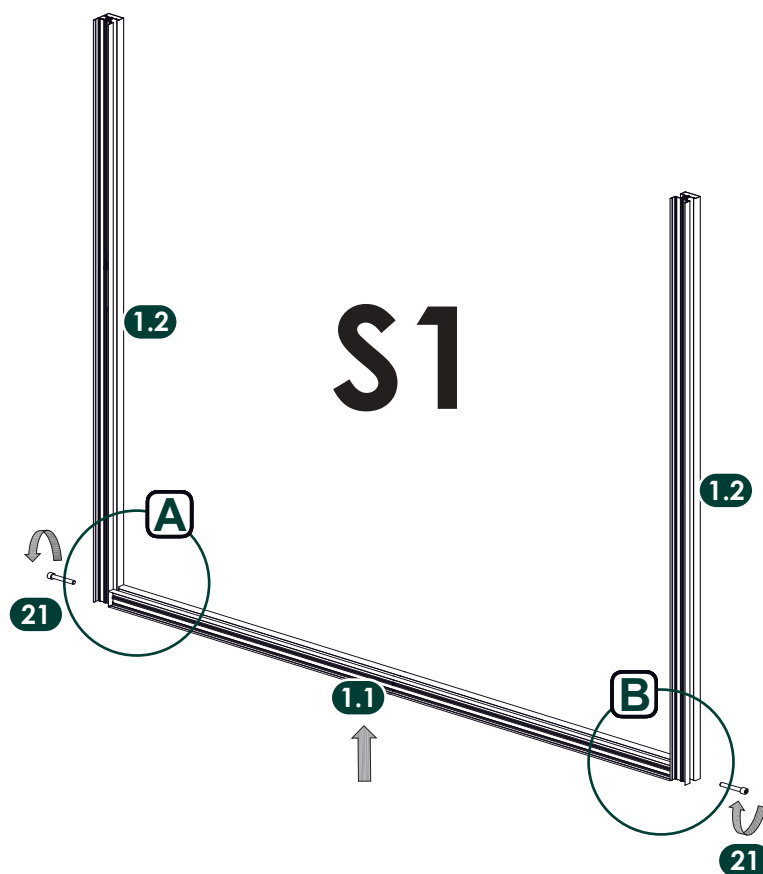

DETAIL


A

DETAIL

B

strana
13

7.

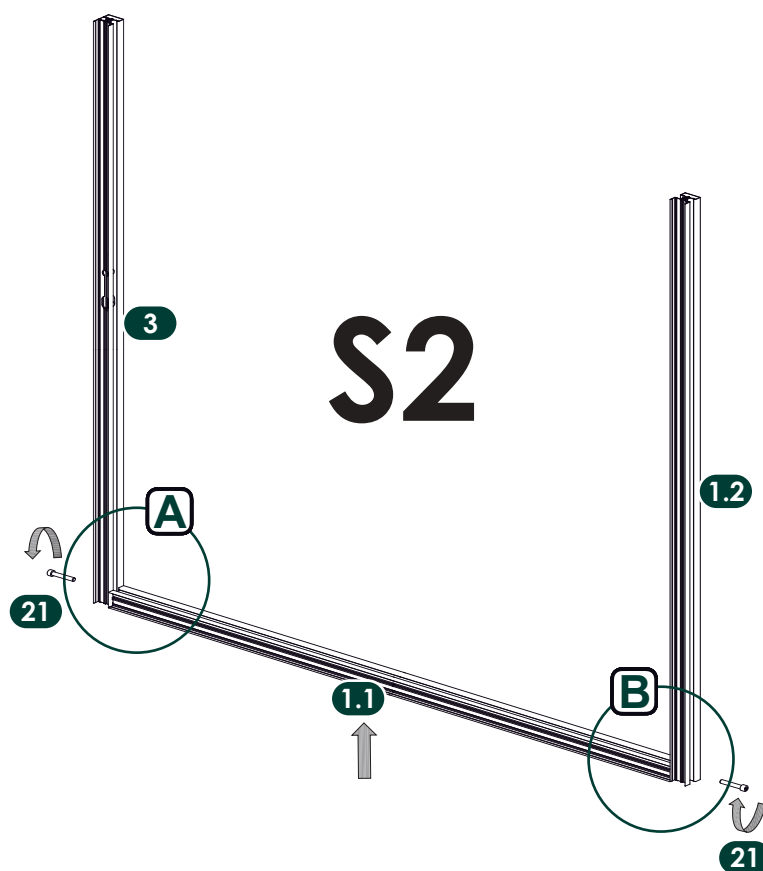

DETAIL





A


DETAIL

B


strana
13

8.

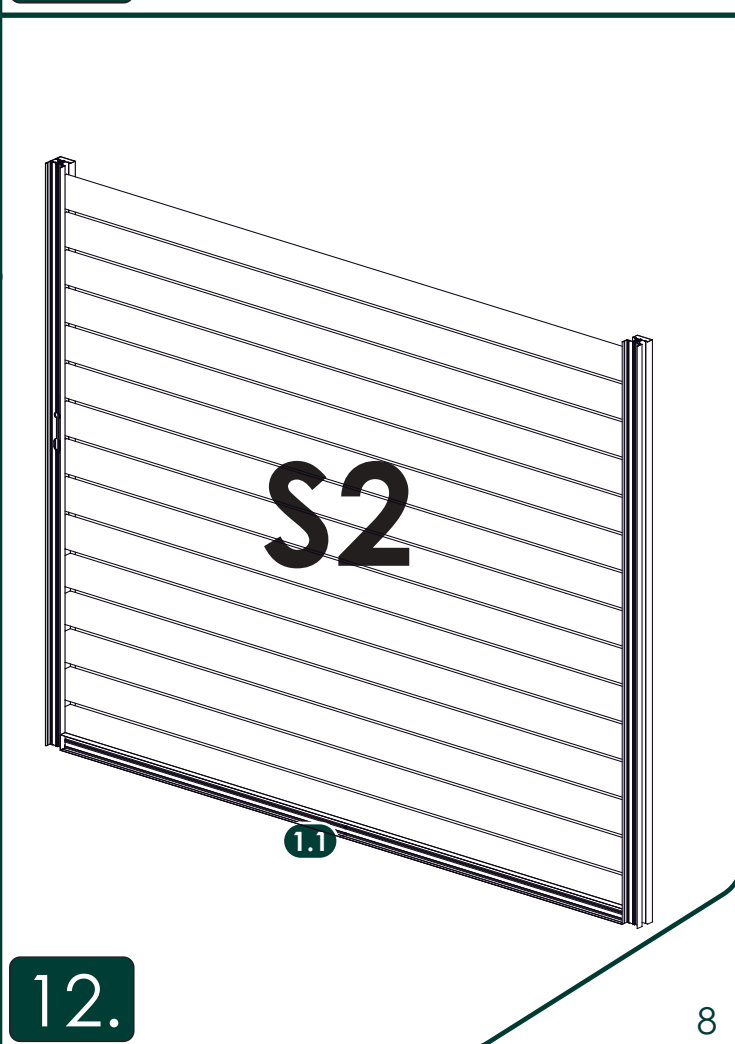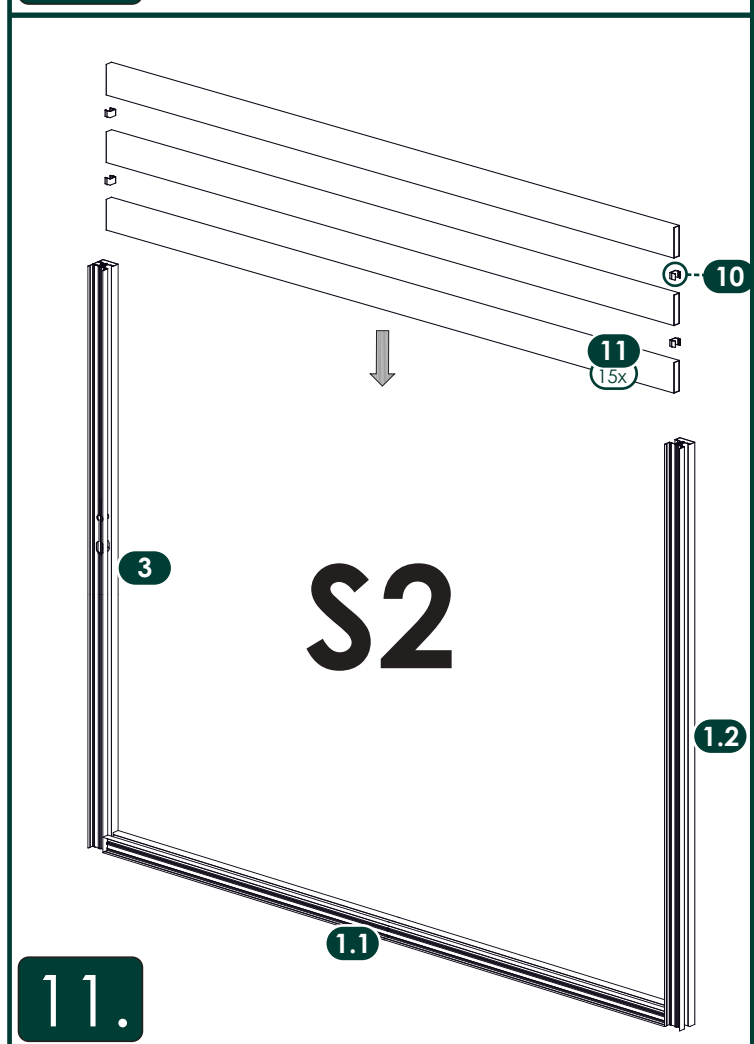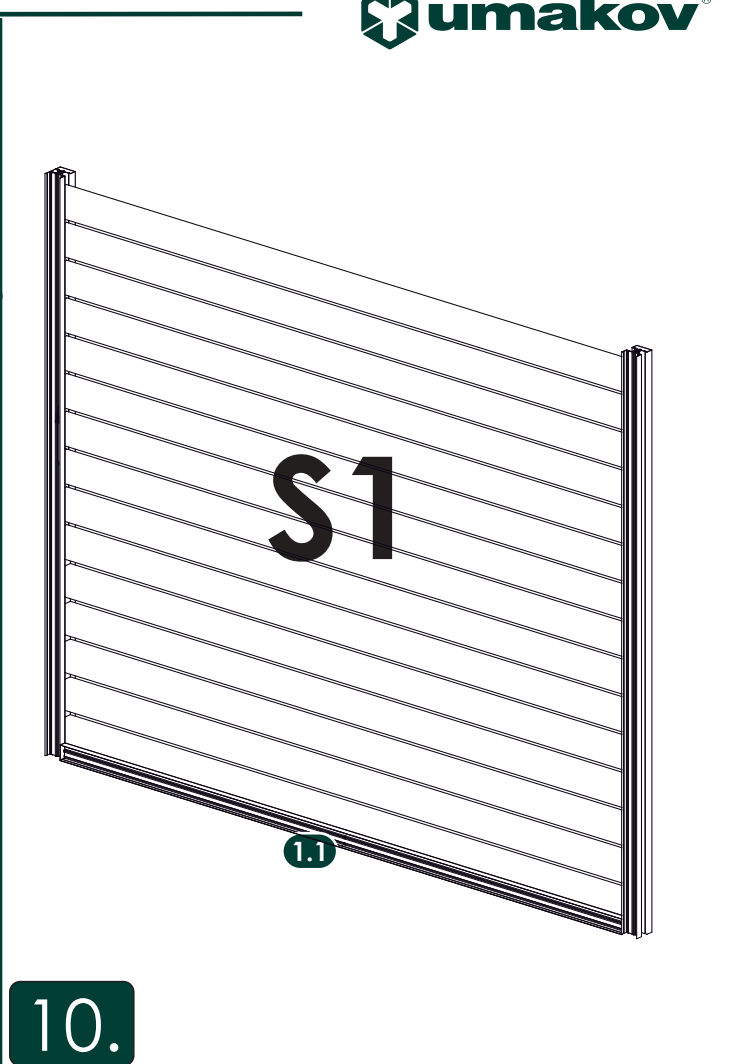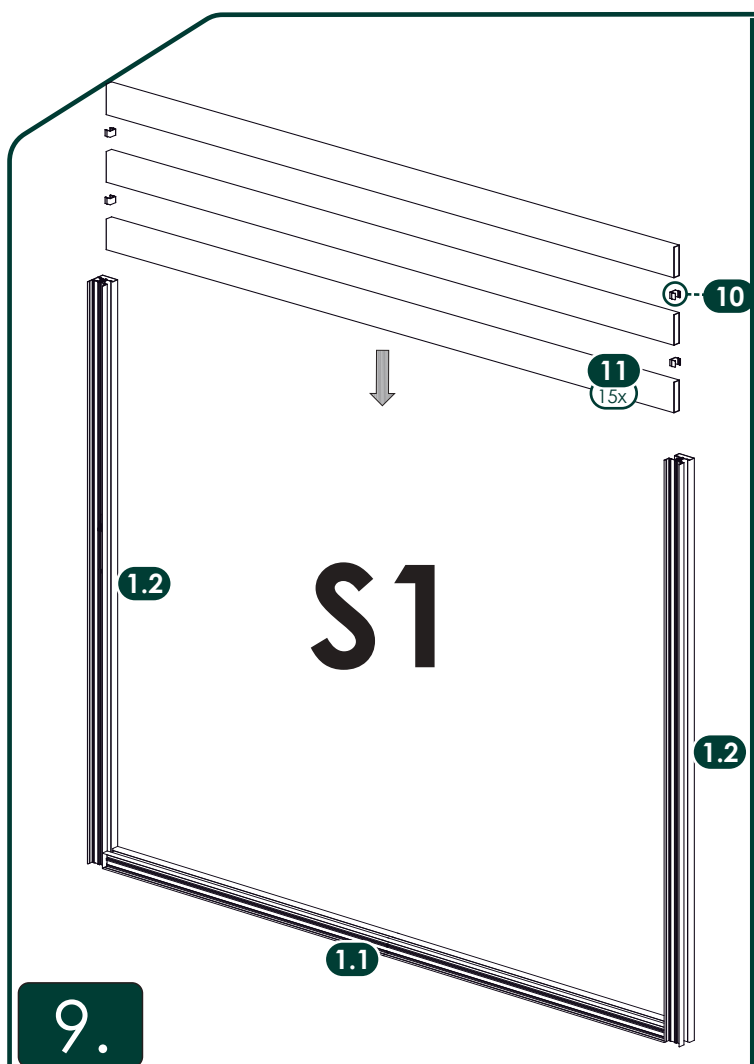


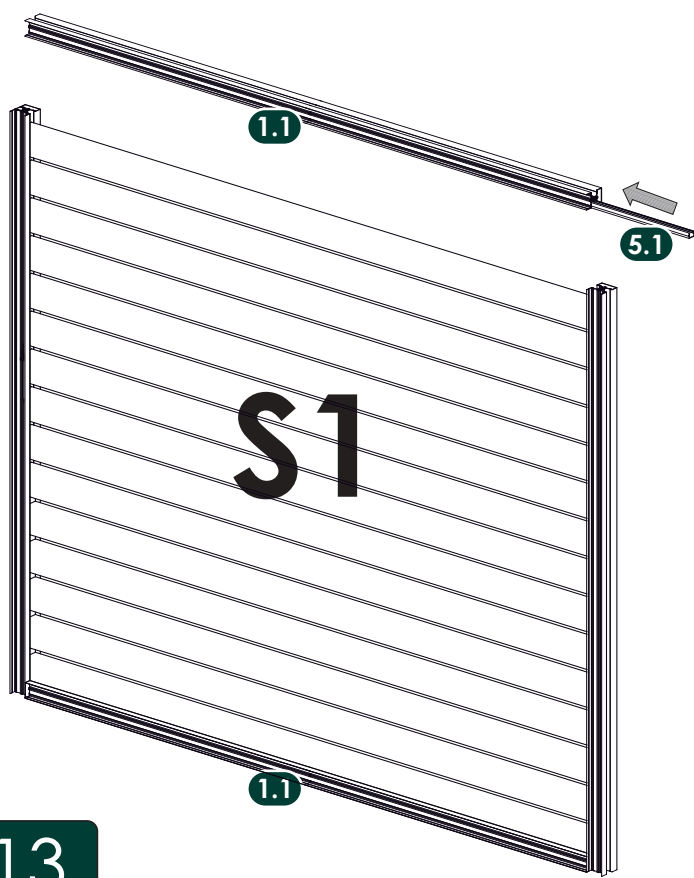


13.

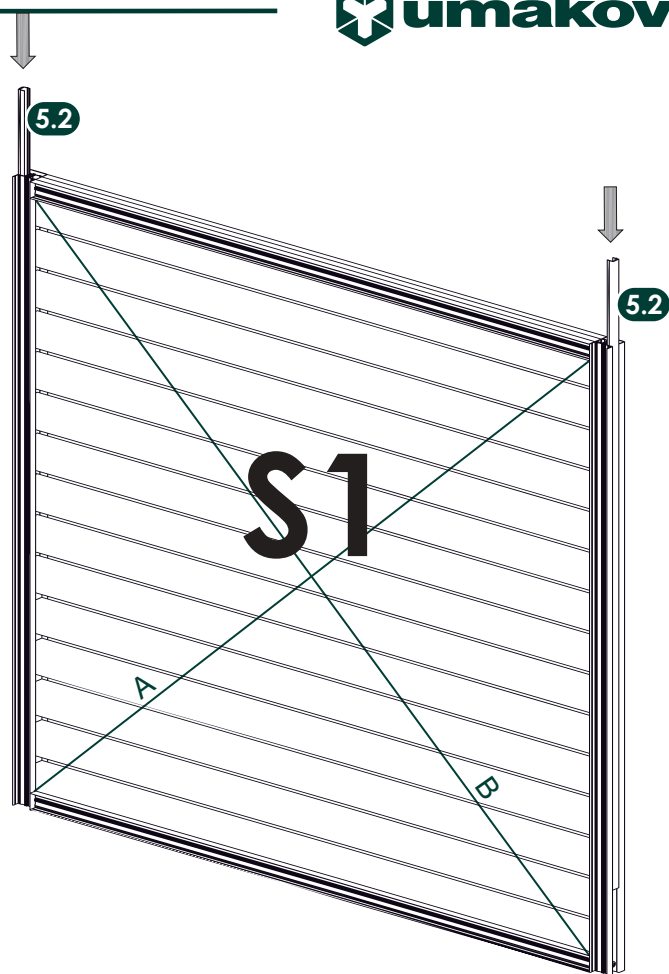



14.




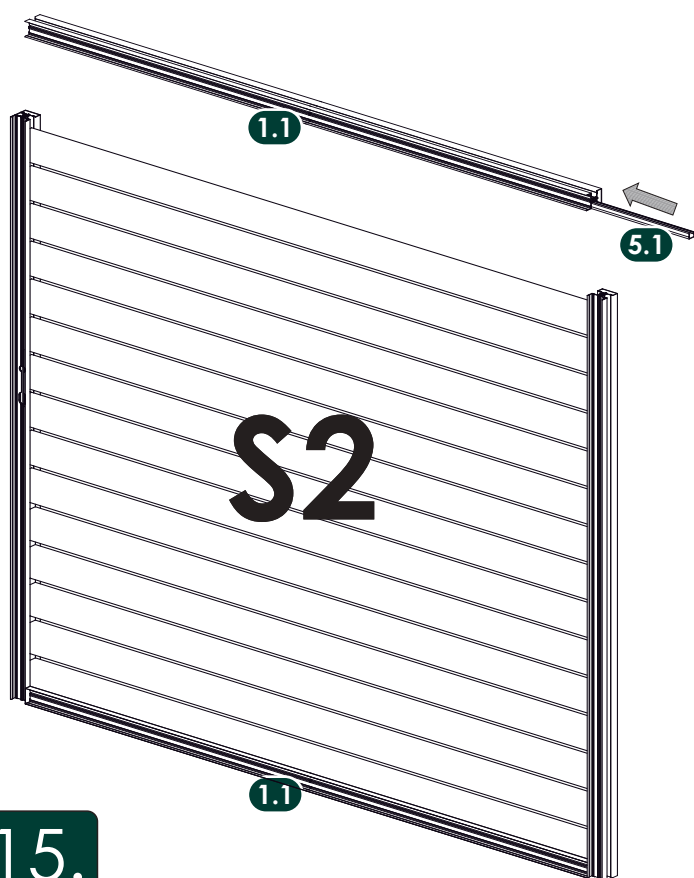



15.

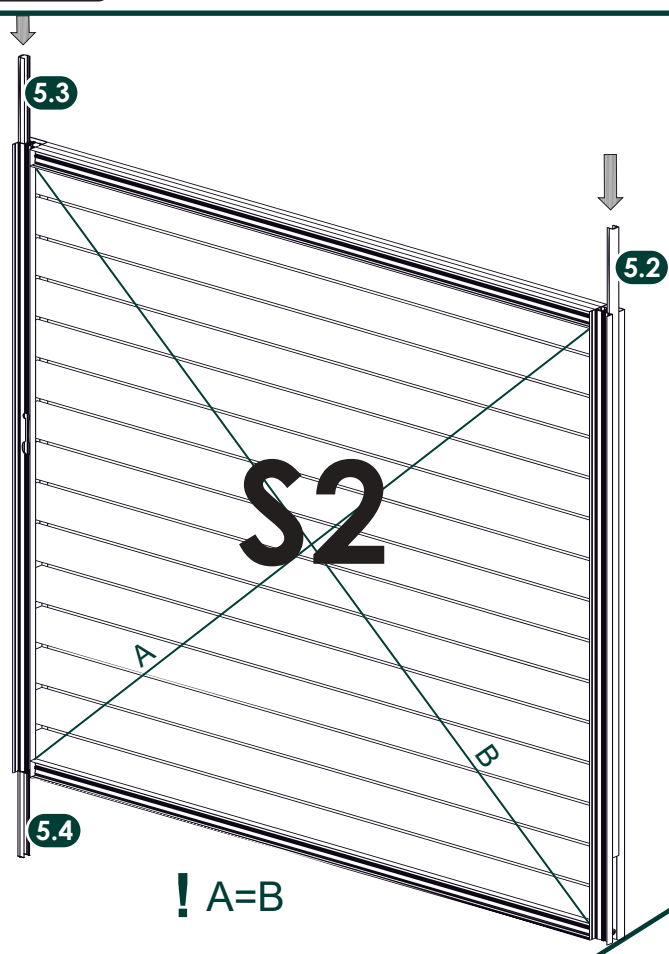

16.

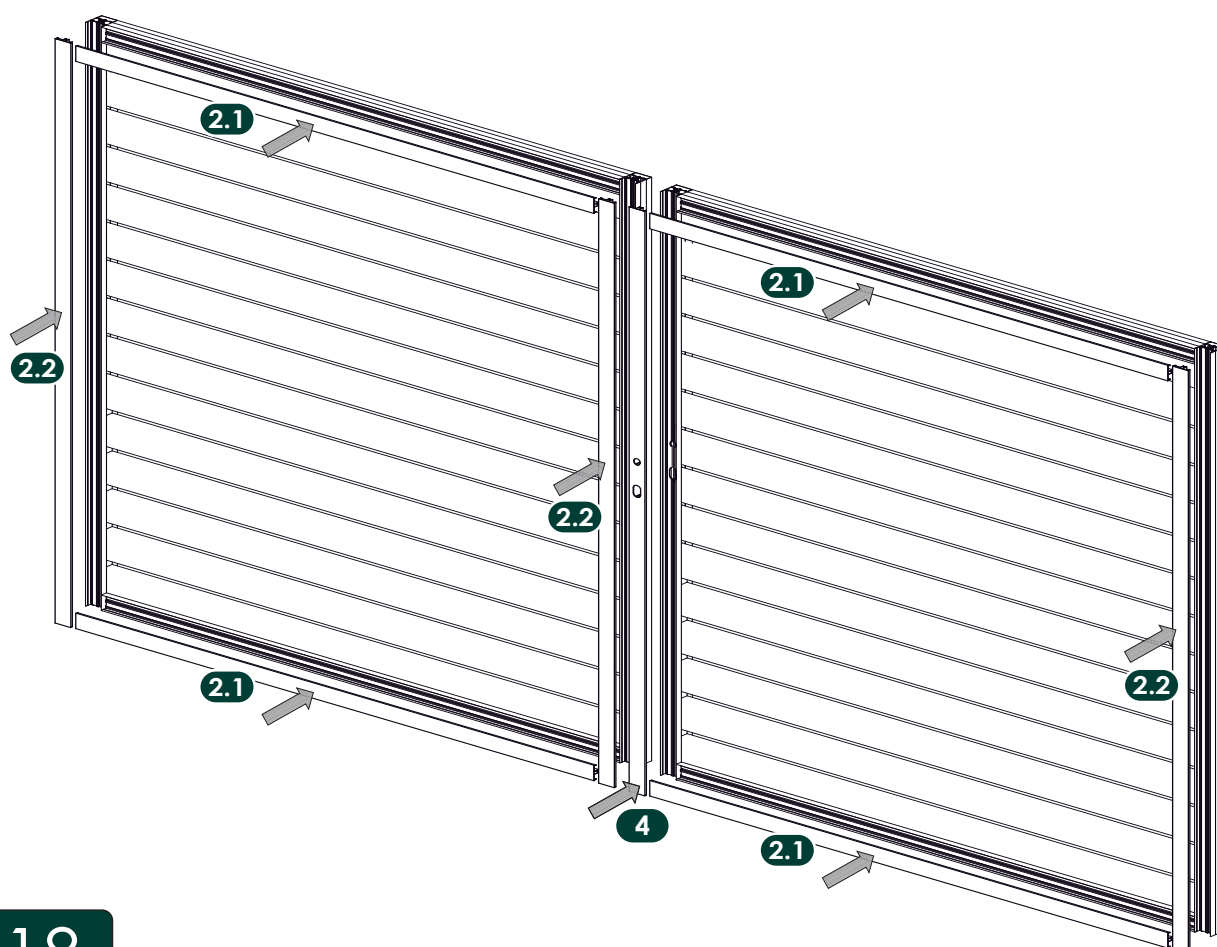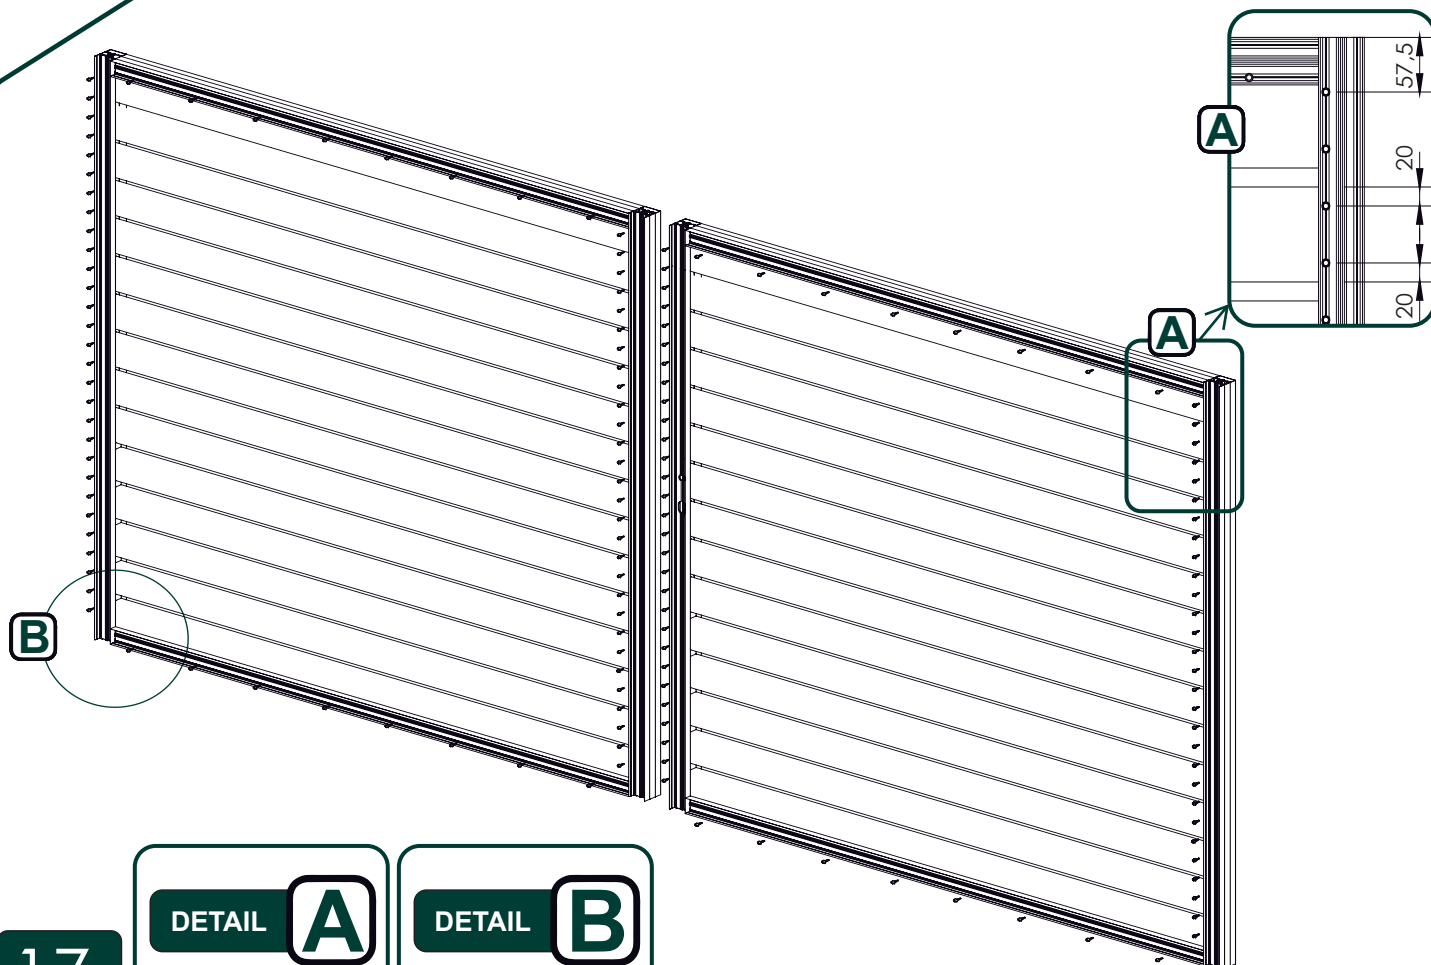

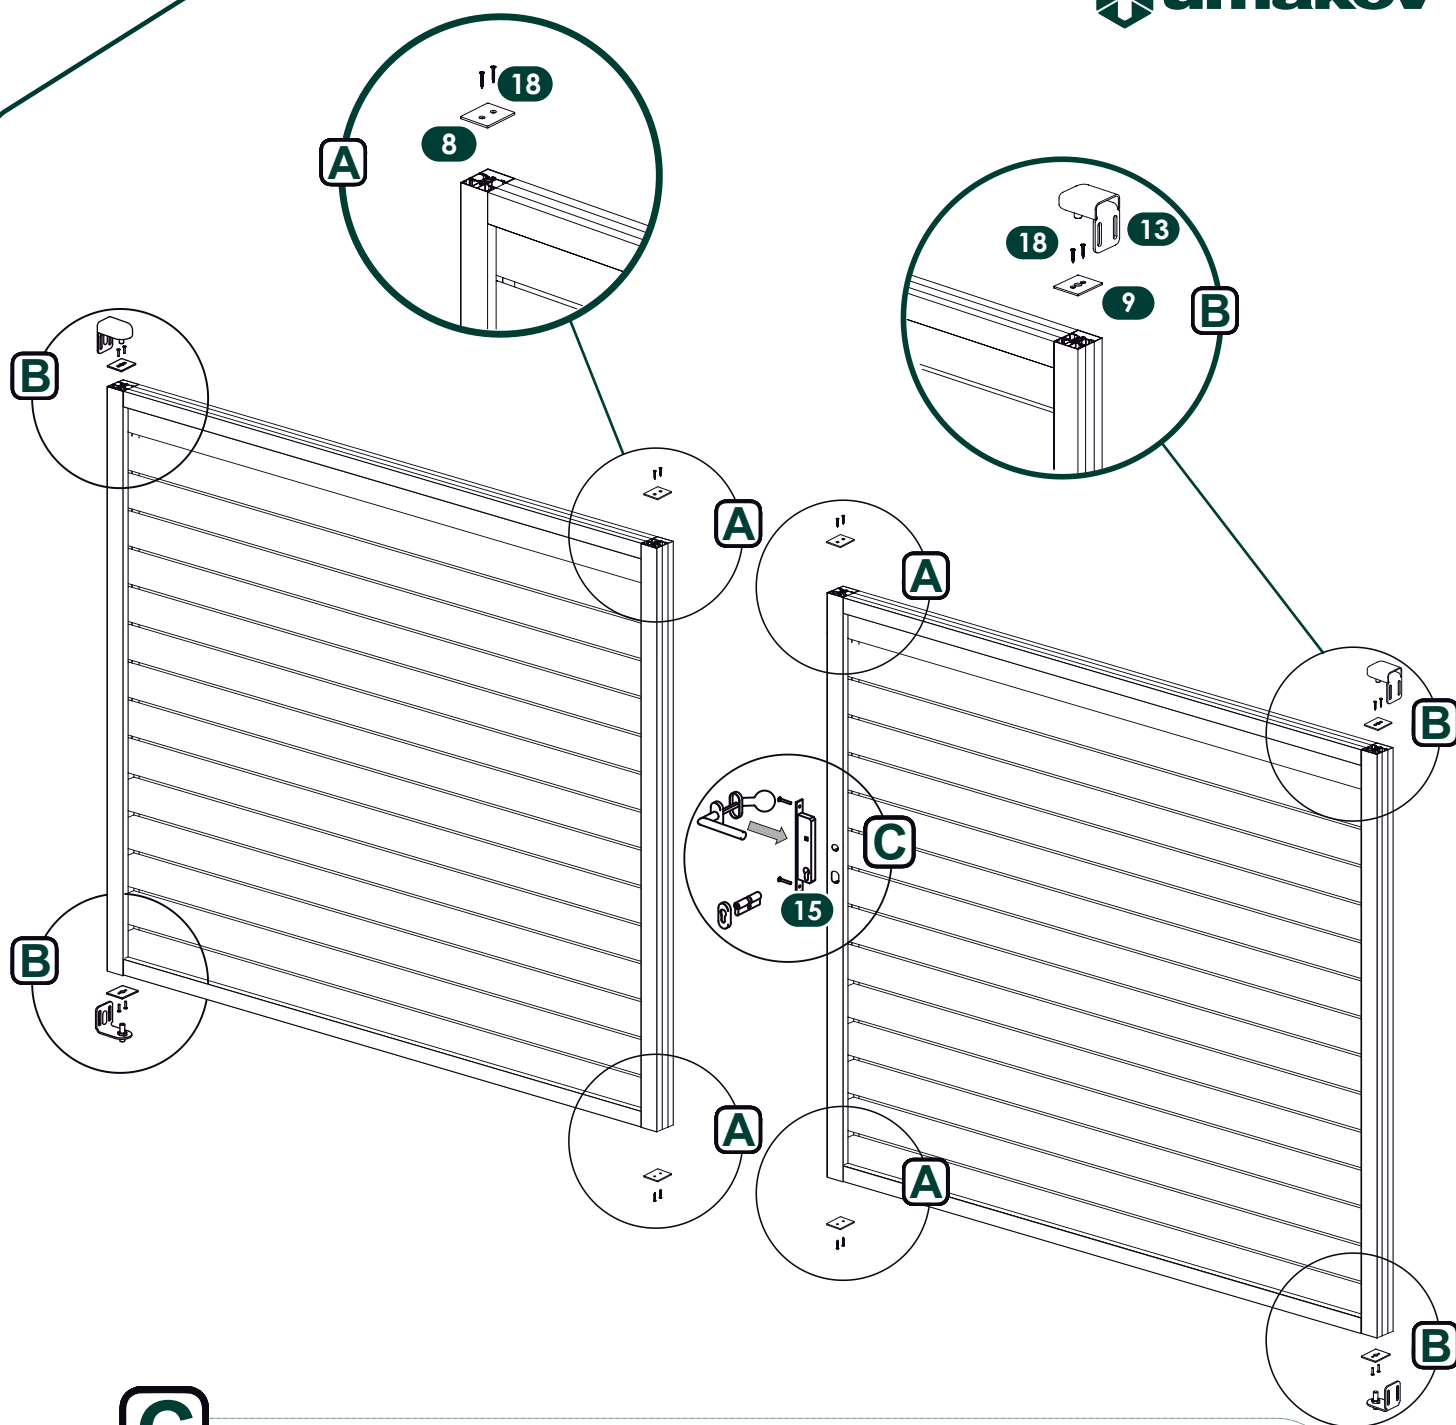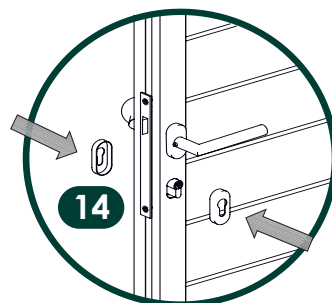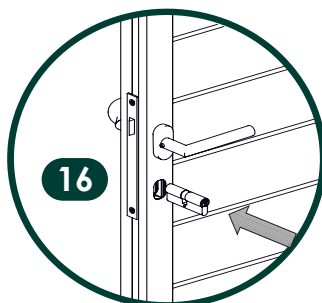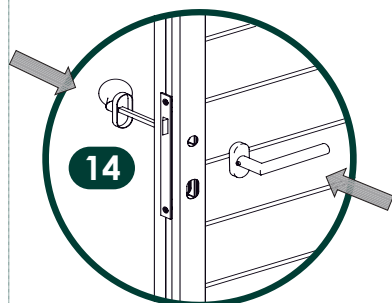
C

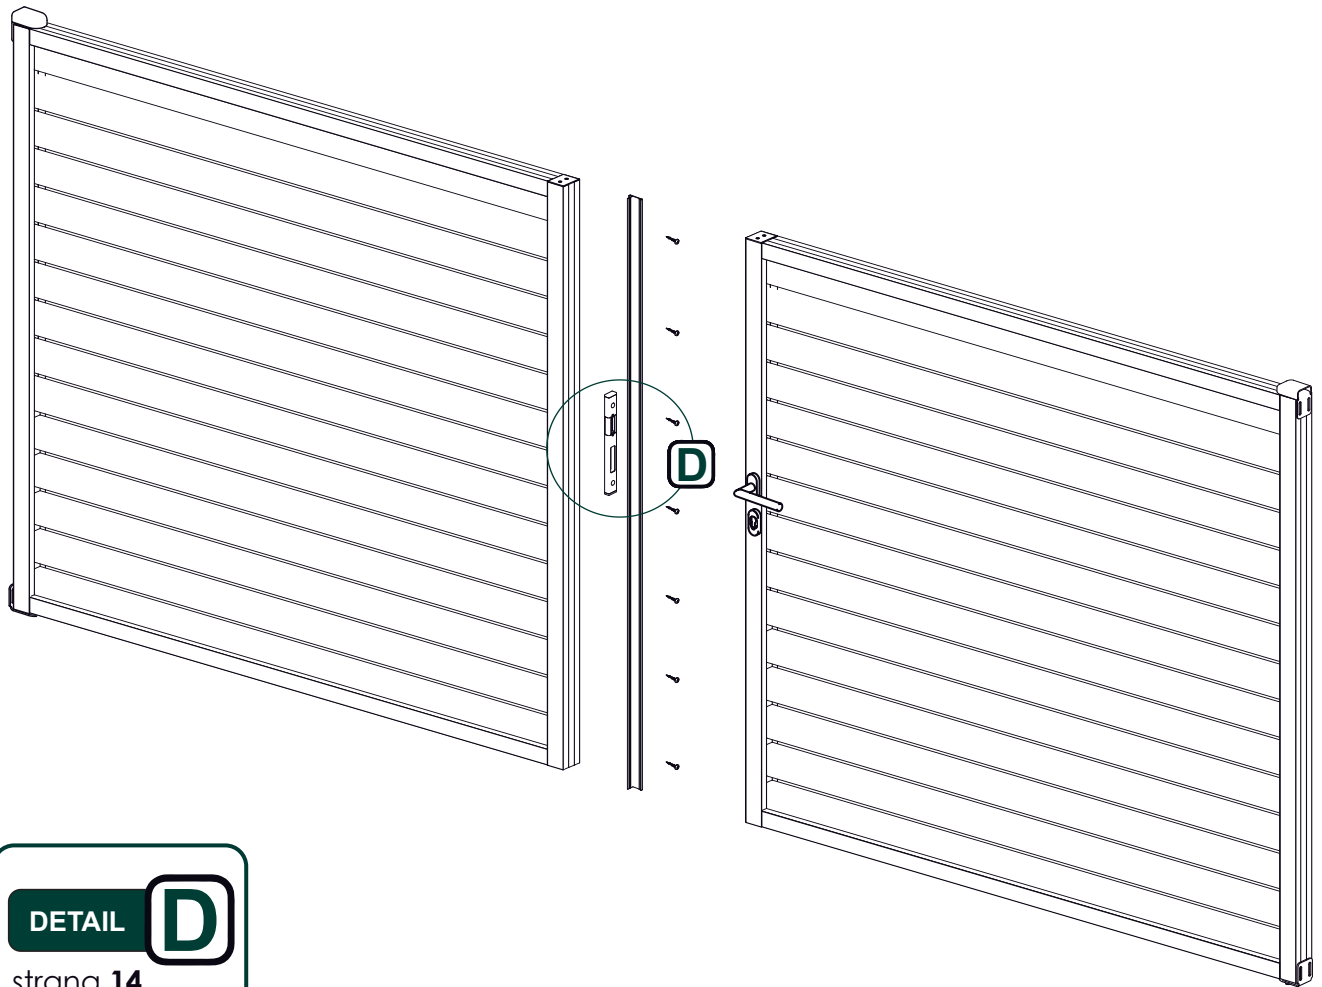
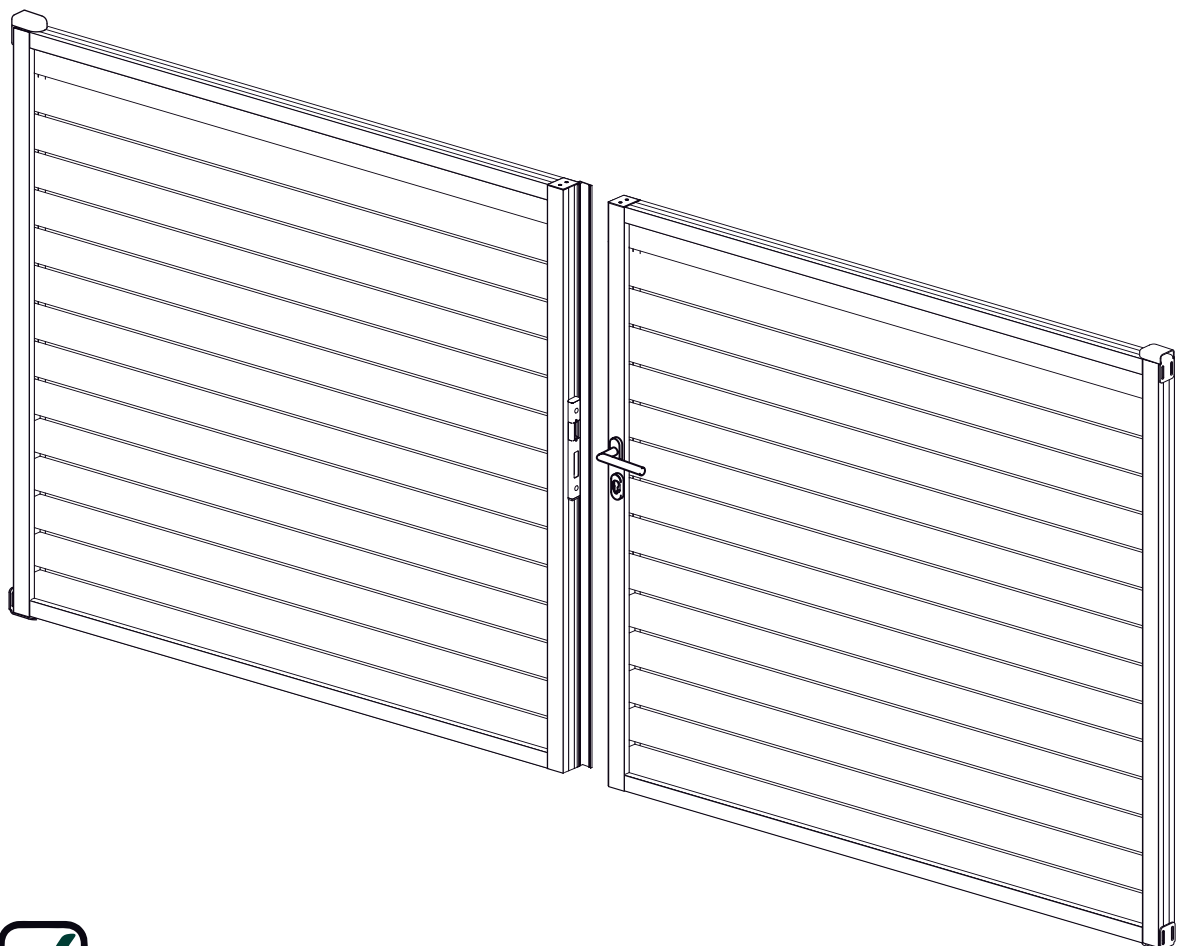


DETAIL

D


strana 14

20.




21.



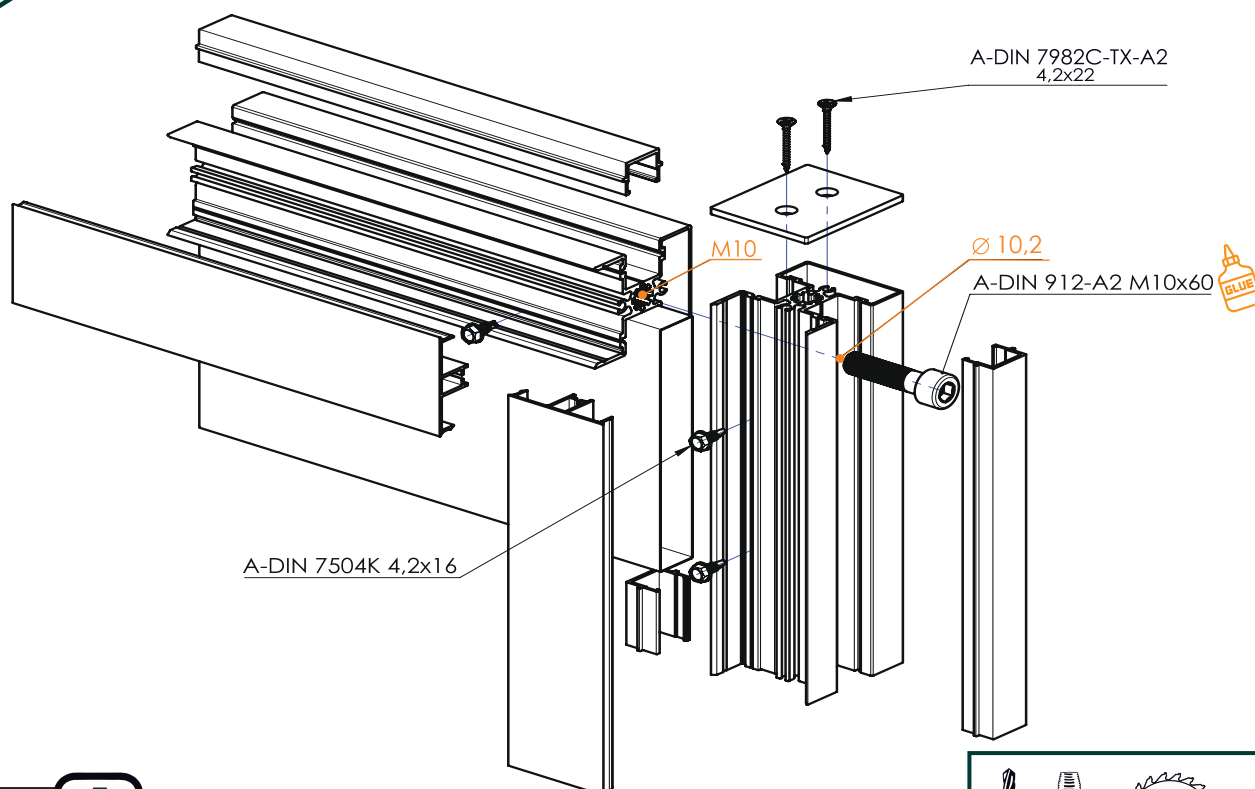



DETAIL
A

ROHOVÝ SPOJ BRÁNY - VŠEOBECNÝ

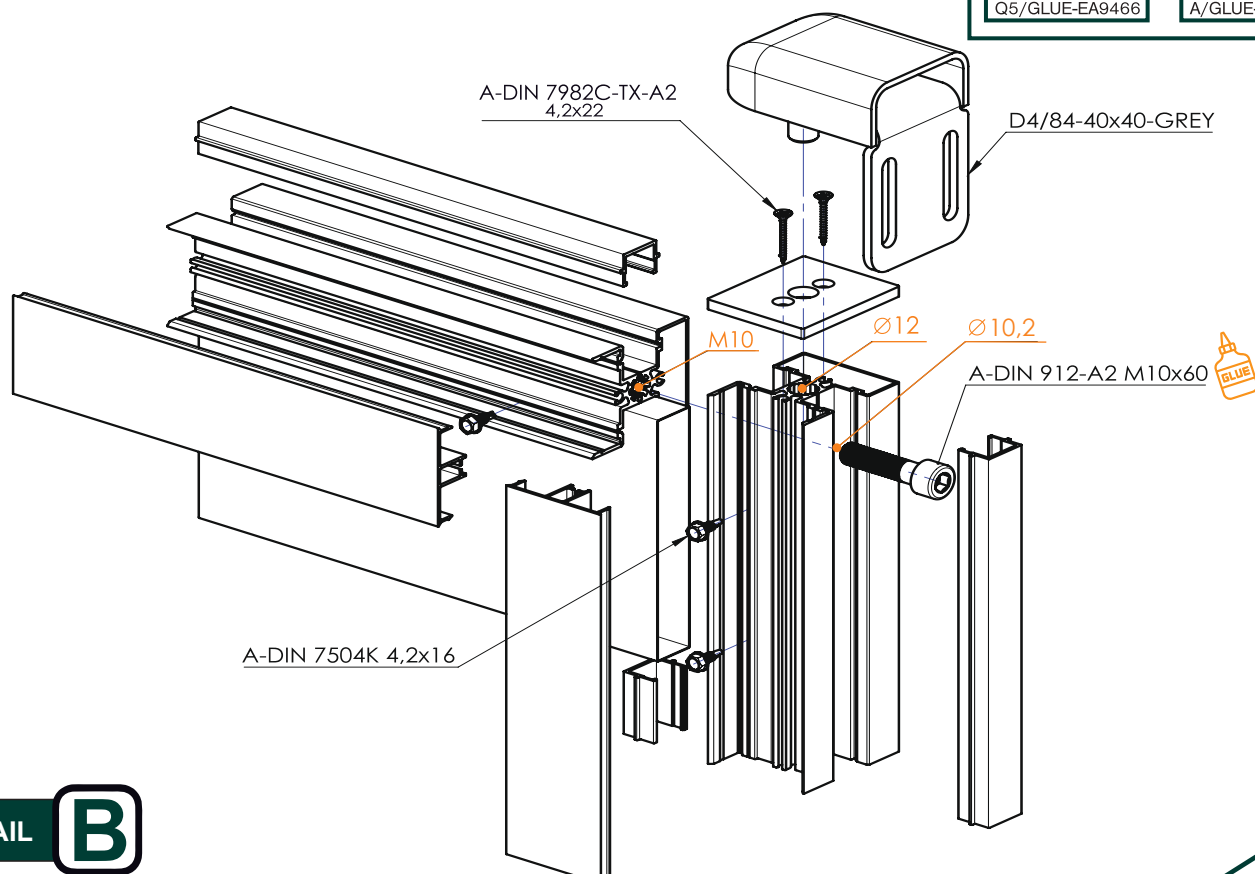
DETAIL
B

ROHOVÝ SPOJ BRÁNY - PÁNTOVÁ ČASŤ

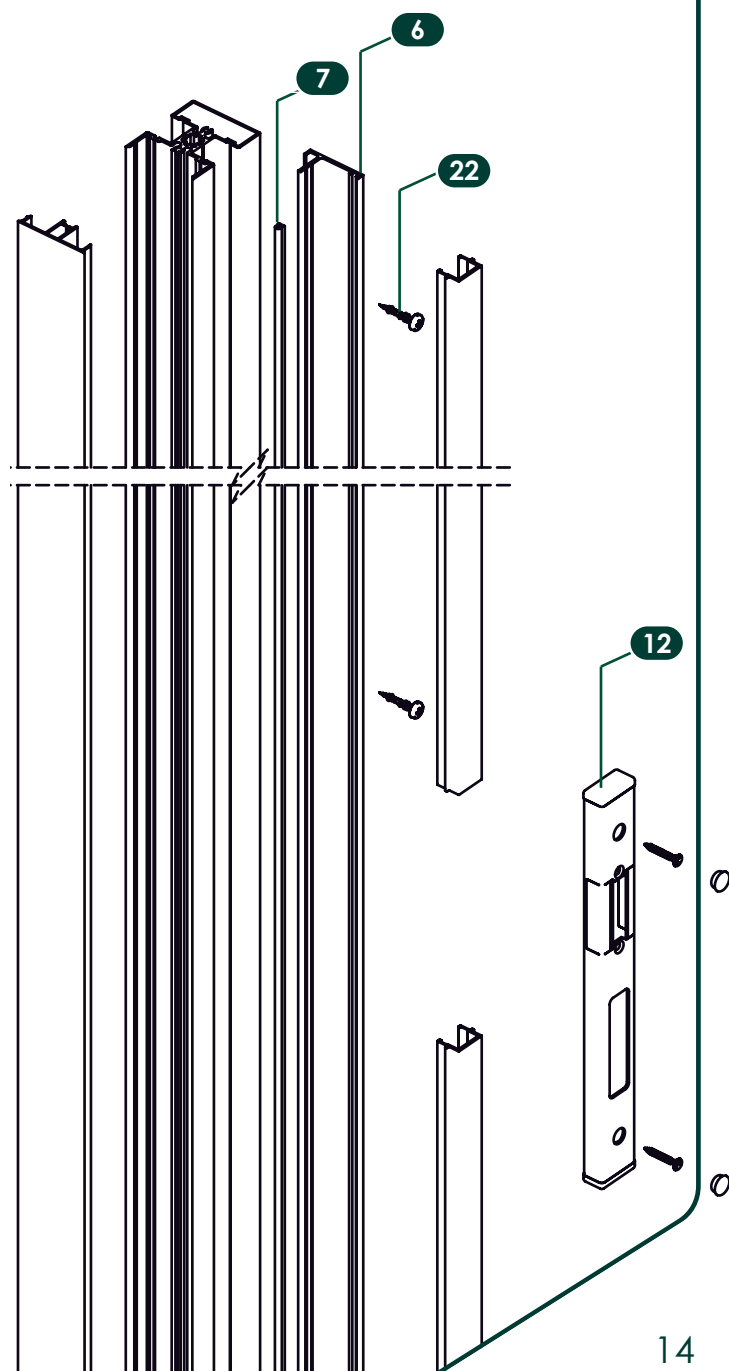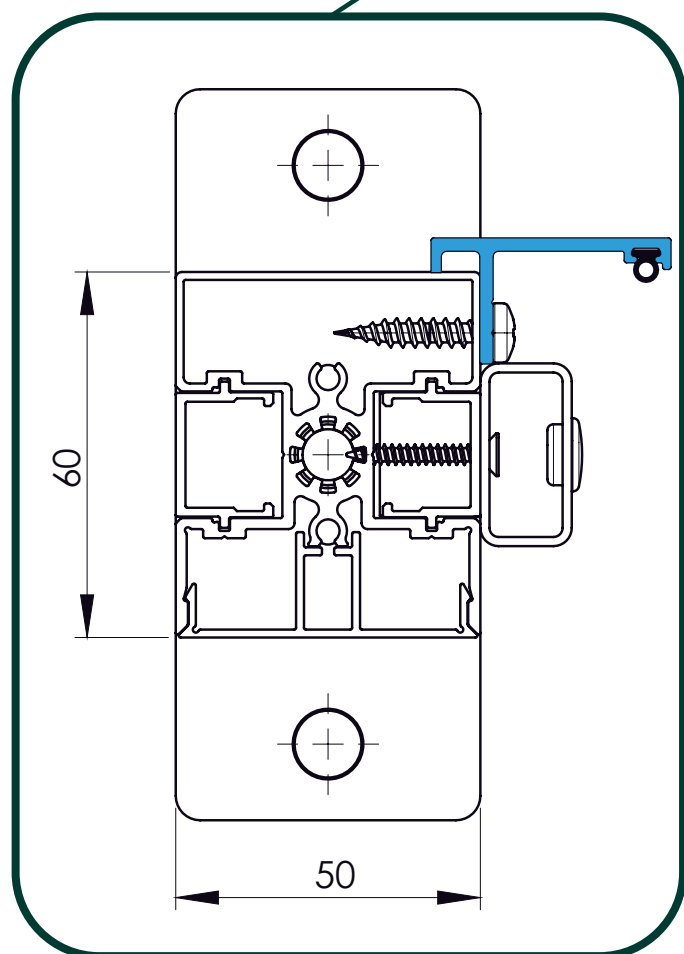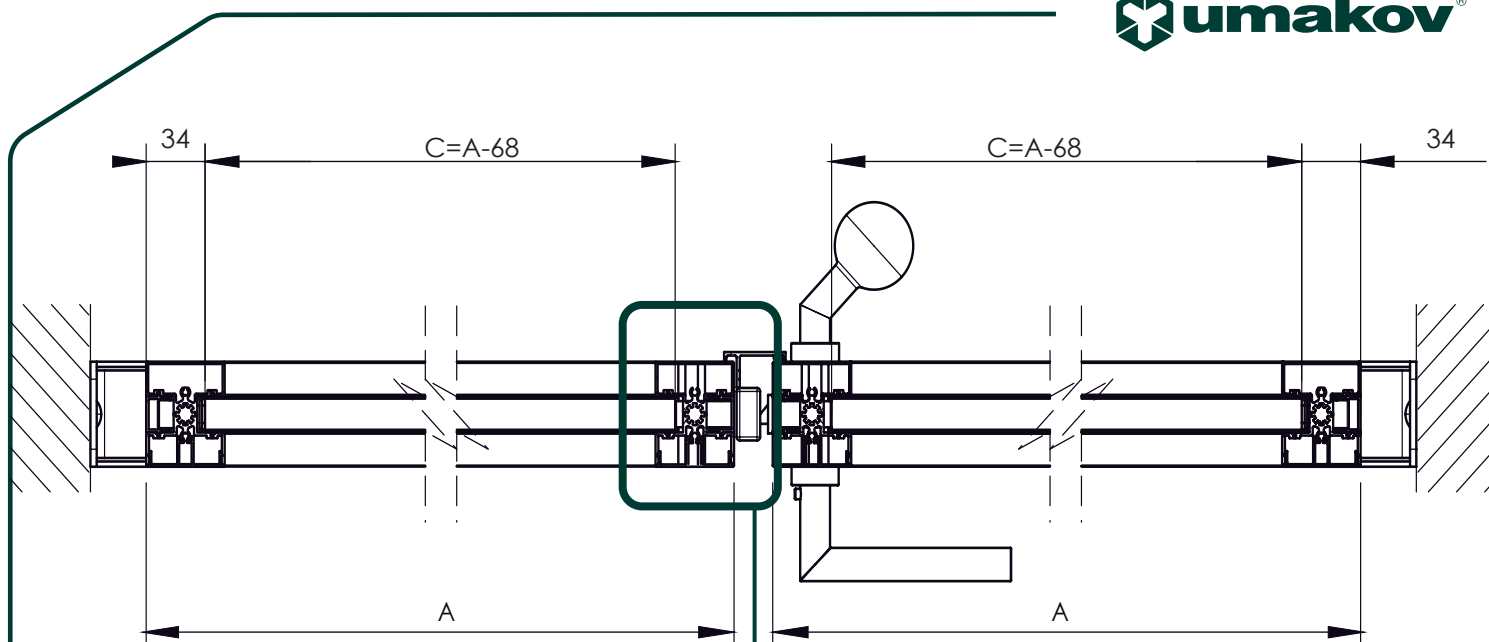

DETAIL

D

MONTÁŽ DORAZOVEJ ČASTI BRÁNY